



TechNews

November 2011 | Volume 4 | Issue 3



| **Super Steels**

| **SRS Diagnosis & Repair**

| **Intelligent Key Systems**

| **Body Basics**

| **Continuously Variable Technologies**

| **Dealer Listing**



*Brought to you by your local Wholesale Mechanical
and Collision Repair Network Dealers*

GENUINE NISSAN PARTS. THE CHOICE IS CLEAR.

	Genuine Nissan Parts	Generic Parts
Manufactured on original dies or molds	✓	
Uses same grade of steel, aluminum or plastic as original part	✓	
Works properly with existing safety and crush zones systems	✓	
Provides the same fit and finish as original part	✓	
Factory surface treatment and bonded primer	✓	
Speeds up repair cycle-time	✓	
Provides highest level of customer satisfaction	✓	

TRUST THE ORIGINAL. GENUINE NISSAN PARTS.

LOOK
CLOSER

Nissan Delivers. Don't settle for anything less than Nissan Original Equipment replacement parts. There is nothing that compares to a precision-engineered replacement part from Nissan. Your customers deserve the benefits of perfect factory fit and performance and so do you.

Get the right part and get it fast, because who knows Nissan better than a Nissan Parts Specialist? Your local dealer has fast moving parts in stock and ready to go.

Nissan4parts.com



Purchasing Nissan OEM repair parts has never been easier. Nissan is now a member of CollisionLink, the most advanced parts ordering network. Check with your local dealer for details.



Start Receiving your Rewards!

Nissan North America has teamed up with Advantage Awards to offer you the most comprehensive online reward catalog available in the repair industry. Parts Reward Points are issued to enrolled repair shops on qualifying Genuine Parts purchases from participating Nissan and Infiniti dealers*.

*See your participating dealer for details and enrollment information.



NISSAN OEM BUMPER ASSEMBLY



SHIFT the way you move



Nissan & Infiniti Tech News is a publication of Nissan North America. No part of this newsletter may be reproduced without the express written permission of Nissan North America.

Group Publisher

Christopher M. Ayers Jr.
cayers@automotivedatamedia.com

Editorial Director

Bob Freudenberger
bfreud@automotivedatamedia.com

Managing Editor

Tom Nash
tnash@automotivedatamedia.com

Contributing Editors

Bob Chabot
bchabot@automotivedatamedia.com

Paul Cortes
pcortes@automotivedatamedia.com

Phil Fournier
ffournier@automotivedatamedia.com

Christian Strohm
cstrohm@automotivedatamedia.com

Art Director

Jef Sturm
jsturm@automotivedatamedia.com

Nissan North America

Project Manager

Don Meier
don.meier@nissan-usa.com

Nissan North America

Technical Content Advisors

Edwin J. Hibma
ed.hibma@nissan-usa.com

James Von Ehr

james.vonehr@nissan-usa.com

Editorial and

Circulation Offices:

134B River Road
Montague, NJ 07827
Phone: 330.620.3929
Website: www.mastertechmag.com

Caution: Vehicle servicing performed by untrained persons could result in serious injury to those persons or others. Information contained in this publication is intended for use by trained, professional auto repair technicians ONLY. This information is provided to inform these technicians of conditions which may occur in some vehicles or to provide information which could assist them in proper servicing of these vehicles.

Properly trained technicians have the equipment, tools, safety instructions, and know-how to perform repairs correctly and safely. If a condition is described, DO NOT assume that a topic covered in these pages automatically applies to your vehicle or that your vehicle has that condition.

Contents

Features



04 | Super Steels

New steels, alloys and materials are forcing a collision repair reboot.




10 | SRS Diagnosis & Repair

With a CONSULT, a Techinfo subscription, and good reading comprehension, SRS diagnosis and repair can be a profitable addition to your shop's repertoire.



16 | Intelligent Key Systems

Understanding Nissan's I-Key can be the "Key to Success" in servicing and repairing the Intelligent Key System.

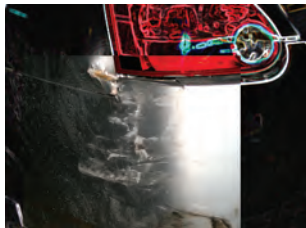

22 | Body Basics Premier Products

In this installment, we'll look at the benefits of using Nissan-approved body alignment equipment and associated tools, bonding and mating products, surface prep, paint and finish products and tools.



26 | Continuously Variable Technologies

Let's take a look at Nissan's Continuously Variable Transmission, including a basic overview of its design, and focus on the independent repair shop's role in servicing, diagnosing, and repairing this different means of applying twisting power.

Department

| 27 Nissan & Infiniti Dealer Listings

| Paradigm Shift: Coming to Grips with Super Steels

New steels, alloys and materials are forcing a collision repair reboot.

The collision industry continues to be under the gun. According to the American Iron and Steel Association, 60 percent of the steels and alloys used in manufacturing cars today did not exist a scant 15 years ago. Since then, the use of new steels and metal alloys by Nissan and other automakers has grown quickly; it is also expected to accelerate over the next two decades.

These new metals must be identified early, as their higher costs impact estimates. Moreover, because they require radically different repair procedures than conventional mild steel, this trend presents a variety of dynamic challenges for collision repair facilities.

The New Mantra: Higher Strength, Lighter Weight, Improved Occupant Safety

In the 1990s, Mild Steel (MS) accounted for nearly all of the steel used in vehicle manufacture. MS offered adequate strength and enabled easier collision repair because of a more stable collision repair knowledge base, somewhat stable manufacturing materials, and simpler repair procedures and skills.


Increasing consumer demand for better performance, improved safety, reduced noise, smoother rides, solid handling and infotainment features are prime change agents. In addition, regulatory initiatives for

better crash safety and roof crush standards, improved fuel economy and lower CO2 emissions have also spurred the OEMs to move away from MS. Also, the advent of heavier, alternate hybrid and all-electric propulsion systems have made the use of higher-strength steels a cost-effective, practical solution.

Over the past decade, innovative new steels, aluminum, magnesium and titanium have been increasingly used by automakers to meet new and inbound regulatory statutes for improved fuel economy, emissions, safety and environmental responsibility. In addition, other new nonmetal materials, such as carbon fiber, polyurethanes and adhesives are being used increasingly.

Compared to mild steel, the newer steel classes (listed in order of increasing strength and formability) include:

- High Strength Steels (HSS), such as bake-hardenable and some dual-phase steels, handle more stress, provide better resistance to fatigue, improve crash energy management, and allow overall vehicle weight reduction and associated cost savings. Better suited for any structural and crash-sensitive parts, HSS are often found in rocker panels, B- and C-pillar reinforcements and cross members.

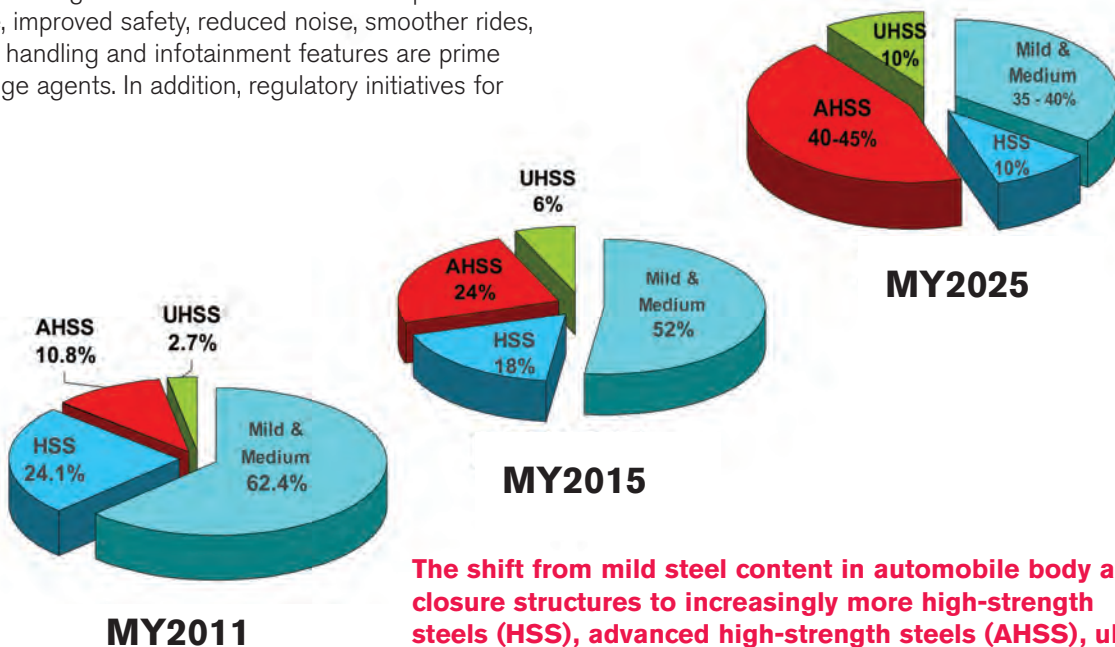

The shift from mild steel content in automobile body and closure structures to increasingly more high-strength steels (HSS), advanced high-strength steels (AHSS), ultra high-strength steels (UHSS), other metal alloys and even nonmetal materials is forcing a shift in collision repair.

Nissan & Infiniti Super Steels

- Advanced High-Strength Steels (AHSS), which include more advanced Dual-Phase Steels (DPS) and Transformation-Induced Plasticity steels (TRIP), have similar initial yield strengths as HSS, but also have much higher final part strength and provide higher energy absorption at a lower overall cost than both MS or HSS parts. AHSS content is typically found in roof panels, front rails, crush cans, and reinforcing inner rockers and pillars.
- Ultra-High-Strength Steels (UHSS), such as boron steel, incorporate molybdenum to create steel with benefits that only higher-priced aluminum or titanium could offer in the past, but at a lower cost. Applications include door beams and bumper beams.

For Nissan and Infiniti vehicles, these benefits translate into increased strength, lightweight composition, improved energy absorption at impact and safer energy transfer around the passenger cabin during a collision. It is not unusual today for 40 percent of a new vehicle's composition to be AHSS or other high-strength metals; in a number of cases, such as the Nissan GT-R, that percentage can be much higher.

Rethinking Collision Repair

"Increasing vehicle structure complexity has the potential to put us all out of business," says Jeffery Poole, performance training coordinator for the Inter-Industry Conference on Auto Collision Repair (I-CAR). "But maximizing survivability has been the driver in automobile design, not repairability." By incorporating stronger steels in key areas — such as B-pillars, rails, cross members and fuel tank reinforcements — collision energy forces can be controlled and transferred away from occupants.


Looking forward, collision shops must adapt their repair knowledge, procedures and skills at an accelerating rate to keep pace with technological changes being made to vehicle structures. While some shops may find the task overwhelming, others will seize the opportunity. Either way, a facility's survival will hinge on replacing old repair paradigms with a thorough understanding of these new materials.

The shift from mild towards increased higher-strength metals has fostered a number of wide-ranging challenges for collision professionals, including the ability to:

- Source accurate service information for collision

repair, with specific access to locations of various steels in a vehicle structure. For example, some structures may require partial disassembly before you are able to prepare an accurate estimate for repair. Nissan's www.nissan-techinfo.com and Infiniti's www.infiniti-techinfo.com websites provide the most current and accurate information available.

- Identify the type of steel in an assembly to then determine whether to repair or replace. While automakers provide guidance specific to each type of steel present in their vehicle structures, repair professionals should be aware that Nissan and Infiniti recommendations for steel classifications may differ from those of other automakers. Don't assume that what works for one manufacturer works for all.
- Determine whether or not there are multiple steel types within damaged assemblies. B-pillars, for instance, can be made from a combination of MS, HSS and AHSS; repair procedures may vary according to each steel type. Both service information and industry-recognized training are resources to help you determine the appropriate repair procedures for each Nissan and Infiniti model and year.

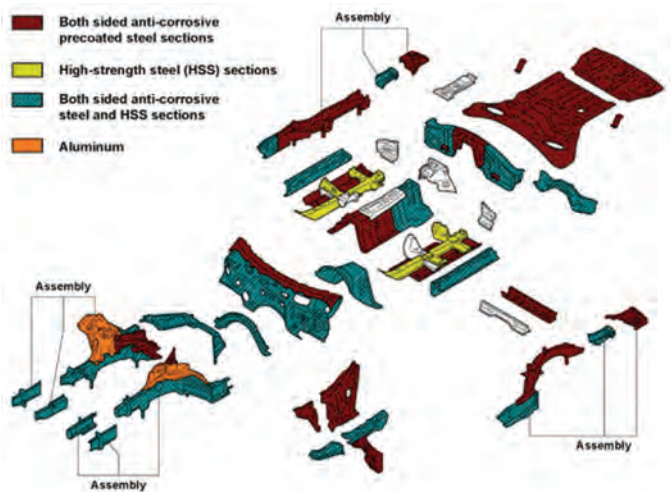

Nissan provides color-coded diagrams of its vehicles that denote the location of various types of steels and other metals in its vehicles, such as this one for the GT-R. Used in conjunction with Nissan service information, recommended repair procedures and proper equipment, these resources help facilitate complete, safe repairs.



I-CAR offers several collision repair courses focused on higher-strength metals. For example, Nissan and I-CAR partnered in developing a GT-R course, available to professionals, that Nissan recommends.

- Learn the specific and appropriate repair procedures that must be used to restore a vehicle to its pre-collision state. Repairers must know, based on steel type, whether heat or cold straightening is appropriate, whether sectioning or replacement is needed, what type of welding is required and more. I-CAR, for example, offers a one-day course focused entirely on collision repair for the GT-R supercar. In addition, I-CAR has just successfully piloted a new course titled “Best Practices for High Strength Steel Repairs” that addresses the challenges of working with HSS, AHSS, UHSS and some of the identified best practices that a shop should utilize whenever working with these materials. Expect this course to be available to the industry shortly.

- Equip facilities with Nissan and Infiniti-approved collision repair equipment. Visit Nissan Tech-Mate at www.nissantechmate.com to seek advice or lists of required/recommended collision repair equipment that has been approved by the automaker. For example, Nissan recommends the use of a Celette dedicated fixture system for GT-Rs to help restore the original accuracy to the vehicle.

Customers should also be informed that they can insist that only genuine Nissan collision parts be used to complete repairs. Nissan provides a form that facili-

ties can provide to customers for this purpose. Insisting on genuine parts meets Nissan design specifications maintains vehicle and corrosion warranty protection, provides time-saving form and fit and avoids compromising post-repair occupant safety, should a repaired vehicle be involved in a future collision. For example, the hood on an electric LEAF is designed with hood buckling creases to help prevent the hood from penetrating the cabin interior; non-genuine aftermarket hoods may not provide such built-in safeguards.

Implementing New Repair Procedures

Technological change has impacted the mechanical side of the service and repair industry for a longer period than the more recent innovations now affecting the collision side. As a result, mechanical service information is abundant and service information gaps are few. However, the recent and very rapid influx of newer steels, metals and other advanced materials requires ongoing collaboration among Nissan, the collision industry, trainers and regulators to ensure that vehicles are repaired safely and completely.

“We must employ better repair planning right from the start,” says Bob Keith, senior director of Education and Training, CARSTAR Franchise Systems. “We need to be



Having a sound repair plan right from the beginning is critical for the collision repair of newer steels, aluminum and other metals. Follow Nissan recommendations and resources regarding the use of heat, sectioning, replacement, welding, documentation and other procedures to ensure that repairs are cosmetically pleasing, maintain the crash-safety rating and protect the facility and staff from future legal repercussions.

better researchers in order to find the correct repair information to ensure we're on the right repair track.”

Once an accident occurs, it is essential that a facility determine what is wrong through proper identification and accurate measurement. Research may be necessary to discern what metals are present and the associated repair procedures and proper equipment required to return the vehicle to pre-crash condition. Then they must thoroughly document and present this information to both insurers and customers.

Access to repair information can be another hurdle. “We need to continue to work with Nissan to get collision repair service information,” says Keith. “I don't think repairers are aware how much information is out there and where to find it.”

Nissan makes collision repair information available through its aforementioned websites. While most information is available, occasionally “time-lags” occur — instances where new vehicles are sold and then involved in an accident before collision repair information and procedures are developed and posted on service information websites. Fortunately, the automaker has signed the National Automotive Service Task

Force (NASTF) agreement, which requires that any genuine gap identified by a dealer or independent facility, including collision repair issues, be addressed, responded to and resolved.

Most collision facilities, however, are unaware that they can electronically file a collision-related NASTF Information Request should they have a bona fide information gap that needs to be closed. While not one Nissan collision information request has been filed with NASTF to date, it is important to know the option is there. To file a request, visit www.nastf.org/i4a/pages/index.cfm?pageid=3290 at the NASTF website.

“Automakers, such as Nissan, have gradually evolved repair procedure policies because they don't want repairers re-engineering vehicles,” Poole points out. “The information is out there, but some of it isn't easy to get to. Should no repair procedure exist for a part made with these new steels, collision facilities must err on the side of safety, even though more costly, and choose replacement rather than repair. Ensuring the insurer and customer are aware of this, and why, before a repair is essential.”

No More Repair Shortcuts

Knowing where new metals and materials are located is a good first step. But facilities must also be able to complete a proper repair. Traditional repair procedures often cannot be used, as they can damage or destroy the attributes and performance of new steels. Instead, radically different repair procedures specific to new steel types must be implemented. To be fully competent and do no harm to a vehicle structure, professionals should ensure they review Nissan training material (visit the Nissan-Infiniti service information websites) and attend recognized industry training such as the several courses facilitated by I-CAR (www.i-car.com) that address the identification, estimate preparation and repair of these new materials.

The newer higher-strength steels, for example, must be handled differently from the MS repairers are long familiar with. For instance, as steel strength is increased, it typically becomes harder, more brittle and more sensitive to heat. HSS is generally cold straightened, while AHSS/UHSS is typically not straightened at all. In addition, when MS steel is heated, it is generally strengthened. However, under that same heat, HSS is weakened and AHSS/UHSS can crack, break or be destroyed. "The investment in more expensive, specialized equipment and acquiring new repair skills on a continual basis compound the challenge for collision facilities," adds Keith. "Facilities must invest in specialized equipment and be adept at using more complex welders such as squeeze-type resistance welders that can cost up to \$40,000, plasma cutters and specialized tungsten- carbide drill bits."

In the case of Nissan and Infiniti vehicles, heat should only be used when recommended. Even when welding, follow Nissan and Infiniti recommended welding methods and techniques to minimize the "heataffect zone," maintain warranties and avoid litigation. Increasingly, recommendations are trending towards complete part replacement rather than partial repair using heat.

The days of shortcuts and just repairing vehicles so they "look right" are over. Repairers should be aware that even if an improper heated repair of AHSS looks cosmetically correct, in the event of a future collision it will be unable to absorb or deflect energy as originally designed. Should that occur, collision energy is then transferred into the passenger compartment, which creates a potentially catastrophic liability situation for the facility.

Responsibility and Liability Go Hand-in-Hand

"As an industry, we need to know how to repair a vehicle and how to represent that repair to consumers, insurers and others," Poole explains. "Keeping thorough and complete files for documentation purposes, as well as developing sound communication skills to convey concerns and needs to insurers and customers is no longer an option. Rather, it is a best practice and part of doing business today."

Poole notes that crash investigation experts, when surveying a vehicle damaged in an accident, review the "prior loss history" of a vehicle. In particular, they review the following:

- Was any prior improper repair in the vehicle's history a contributing factor?
- Were incorrect repair techniques used that were cosmetic but undermined the vehicle's safety?
- Were there prior loss issues that were neglected and/or simply not addressed by the last repairer/insurer?
- If a vehicle has had multiple collisions, which facility is responsible for the improper repair?

"The answers to these questions in court can make for an interesting day at the office," Poole cautions. "Failure to provide a correct and ethical repair, document and communicate it can result in devastating liability claims, whether caused by a facility's ignorance or its negligence. Neither is a valid excuse." The challenges that collision shops face today — especially with new steels and materials being integrated into vehicles — have the potential to overwhelm or empower success. A commitment to detail is essential.

This includes being aware of inbound change; staying current with new technology, equipment and tools; embracing ongoing training as an enabler rather than burden; identifying and implementing correct associated repair methods; acquiring and maintaining skill fluency; and documenting and presenting concerns to all vested parties. Clearly, the collision repair learning curve has gone vertical. The question is: Are you ready and engaged in the climb? |

SRS Diagnosis and Repair



With a CONSULT, a Techinfo subscription, and good reading comprehension, SRS diagnosis and repair can be a profitable addition to your shop's repertoire.

The safety information preceding diagnostic or repair information is pretty boring, or, even worse, it's sometimes so obvious it's almost insulting. For instance, even someone completely unfamiliar with auto repair would probably know to turn off the engine before beginning drive belt service, yet warnings similar to this still appear in service manuals. To save time, techs will typically skip over sections marked "WARNING" and jump right to the meat of the procedure.

Don't Skip Over the Safety Information

You shouldn't do this in general, but with SRS, the consequences can be severe, even fatal. An air bag can save your life if you're buckled into the seat, but it can also snap your neck if it deploys when you're out of position while working on the car. Even highly-skilled techs have accidentally deployed air bags. The best way to avoid this is to follow the diagnostic flow chart after reading very carefully, including the warnings. If you deviate from the plan, you're on your own.

Rules of SRS Safety:

Always disconnect the battery before working on or around SRS components. Contact with voltage, even for a millisecond, can cause the squib to fire and the airbag to deploy. Disconnecting the 12V battery and waiting three minutes for capacitors to discharge will eliminate many potential sources of stray voltage while



Remove the negative battery cable and wait three minutes before working near SRS components.

the repair is in progress. Remember, even if you are not working on the SRS system you should be mindful of its presence and follow appropriate safety precautions.



Touch a bare metal component to discharge static electricity from yourself.

Static electricity can cause an air bag to deploy, even when the 12V battery has been disconnected. Shorting bars built into SRS connectors help reduce the risk, but there's always the possibility of tampering or a malfunction. Therefore, it's a good practice to ground yourself before touching SRS components.

Do not use an ohmmeter to check squib resistance. An ohmmeter passes current between the probes and measures voltage drop to determine resistance. This current can cause the squib to fire. Resistance testing of air bags is always done indirectly, either by substituting a known good air bag module or a special service tool, then clearing codes and rechecking. The service manual may call for the use of an ohmmeter, but only on the wiring, and never on components. Make sure you understand what the flow chart is asking for before starting to test.

If you remove an airbag, store it with the metal side down; bag side up. If it goes off for some reason, you'll have a loud pop and you may need to take a tranquillizer, but the airbag will likely stay in the same position. If it's stored with the bag side down and goes off, it will launch and is more likely to cause damage or injury.

Impact sensors can be tripped by vibration and shock during repair; impact wrenches and hammers should not be used near SRS sensors with the key on. Redundant safety systems will probably prevent airbag activation, but do you really want to gamble on it?



An ohmmeter is sometimes used in SRS diagnosis, but ONLY when the service manual calls for it and ONLY in the manner described in the service manual.



Store air bags properly to avoid injury.

SRS Cast of Players

SRS systems have come a long way since the single driver's side air bag found in vehicles of the late '80s. Older SRS ECUs had only one sensor and two output choices: to deploy the driver's air bag or not. Modern

systems have a myriad of sensors and a variety of output choices. The system tailors its response to match the requirements of both the occupants and the collision, analyzing sensor data, making decisions, and taking action in thousandths of a second. Here are some of the players found in the modern SRS system:

Outputs

The driver's front air bag will deploy when the front of the car hits something (or something hits it) hard enough to cause sufficiently rapid deceleration. The driver's air bag module is located in the center of the steering wheel. Modern units are dual-stage, so they can better match the force of inflation to the force of the collision.


The passenger's front air bag is also designed to protect against injury during a head-on collision. The front passenger air bag module is located in the dash on the right side of the car. These too are dual-stage on newer Nissan vehicles.

The side air bag modules are located in the outer edge of the front seat backs, one in the left seat and one in the right seat. The side air bags will deploy only when the vehicle is struck (or strikes something) from the side. Don't be confused by the naming conventions found in the CONSULT and in the service manual. They are sometimes listed as the "Front LH side air bag" and "Front RH side air bag", which sometimes leads technicians to mistakenly believe that side air bag trouble codes were caused by the front air bags. The front air bag modules are almost always referred to as "driver's" and "passenger's".

Side curtain airbags are usually found running above the doors in the outer edges of the headliner on either side. They are designed to protect the occupant's head during a collision, whereas the side air bag modules protect the occupant's torso. The side curtain (head) airbags are deployed whenever the side (torso) airbags are activated.

Seatbelts are also SRS outputs. In the event of a collision, the Air Bag Diagnosis Unit (SRS control unit) will activate seat belt pre-tensioners to remove the slack from the seat belts. Once the occupant's weight is thrown against the seat belt, a load limiter built into the seat belt will release some of the belt tension if it exceeds a specified level.

The seat belt and SRS warning lights are also important outputs. If either light is on while driving, the restraint system may not offer the protection it's capable of delivering.

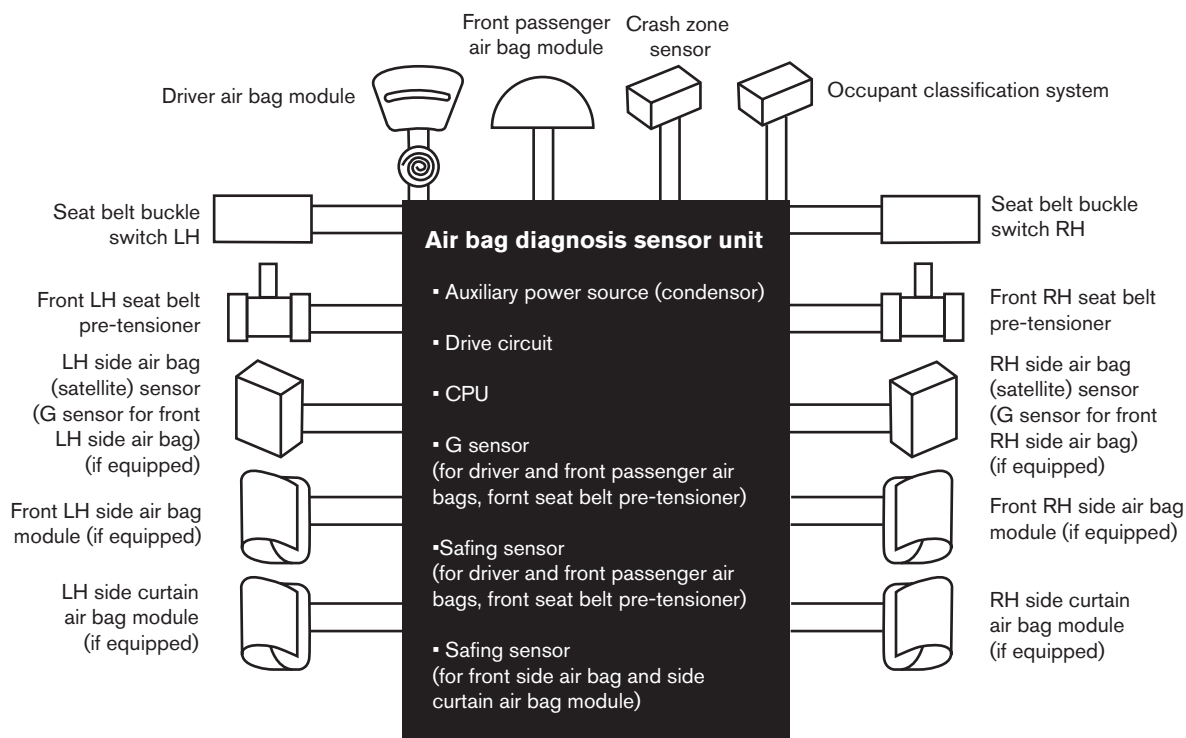

SRS Configuration

Inputs

The SRS Diagnosis Sensor Unit is both an input and a control unit. It monitors sensors and activates outputs, but it also contains several built-in sensors and has other functions:

- A "G" sensor to measure the intensity of deceleration/acceleration.
- Safing sensors. Safing sensors are on/off "weight and spring" switches added as secondary confirmation of a collision to prevent inappropriate deployment. There is usually one safing sensor for the front air bags and pre-tensioner and another for the side air bags and curtain air bags.
- An auxiliary power source in case of power failure during a crash. The power stored in the capacitors is why waiting for three minutes after disconnecting the battery prior to working on the system is necessary.

The seat belt buckle switch is actually two redundant switches. With the seatbelt connected, the SRS Diagnosis Sensor Unit expects to see one switch open

and the other closed. When the seatbelt is disconnected, the switch positions reverse. This way, if a switch fails, the SRS unit will be able to tell and will set a code. The SRS system will activate the front air bag if the seatbelt is not latched, so these are important inputs. Currently, most cars only monitor the front seatbelts.


Crash Zone Sensor

The Crash Zone Sensor is the first to report a frontal collision. It's typically located near the front bumper and provides early warning to the SRS Unit. Its electrical impulse will reach the centrally-located SRS Unit before the force of the shock wave.


The left or right satellite sensor will be the first to report a side impact. They are usually located in the lower "B" pillar area (behind the front doors) and will provide early warning of a side impact to the SRS Unit.

Occupant Classification System

The Occupant Classification System (OCS) is basically a scale in the right front seat. It consists of a

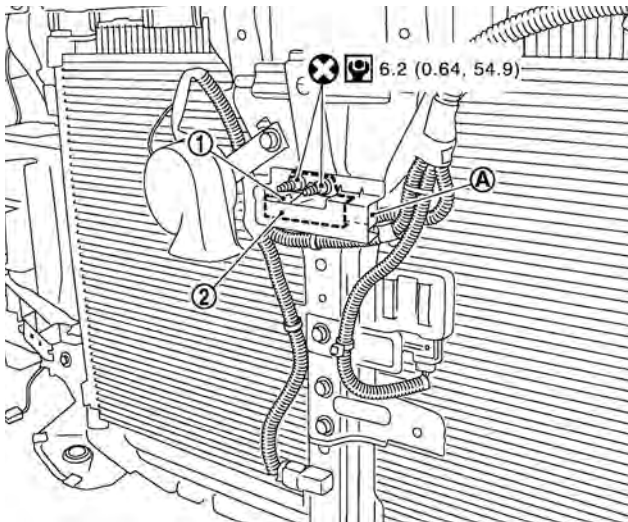

The Crash Zone Sensor is mounted in the front of the car so it's able to report head-on collisions before the shockwave can reach the occupants.

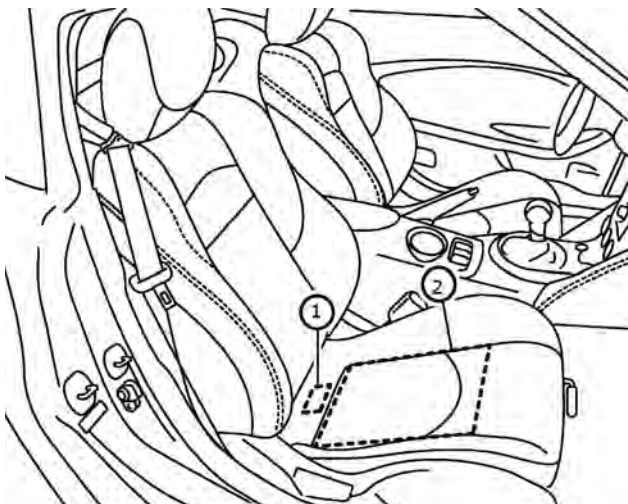

The Occupant Classification System:
1. OCS control unit, 2. OCS sensor mat.


sealed mat filled with goo, a pressure transducer, and a control unit. When a passenger sits on the seat, his weight increases the pressure of the goo in the mat. The pressure transducer measures the increase in

pressure, and the control unit calculates the weight of the passenger. The OCS unit sends the weight information to the SRS unit, where it is used to determine appropriate activation of the passenger air bag during a collision.

Harness and Connectors

The spiral cable is one of the few moving parts (the seat belt switches being another) in the SRS system. The spiral cable sits behind the steering wheel and allows a continuous electrical connection between the driver's air bag module and the SRS unit as the steering wheel is turned.

SRS harnesses are color-coded in yellow to make them easier to identify. The wiring and connectors are top quality, and design and layout are always very well thought-out. Harness failure is rare unless it has been changed from its original configuration. Always reinstall retaining clips and preserve the original routing when disturbing SRS harnesses for any reason. Never attempt to repair an SRS harness unless the manual or TSB specifically call for it, and then only in the exact manner described.

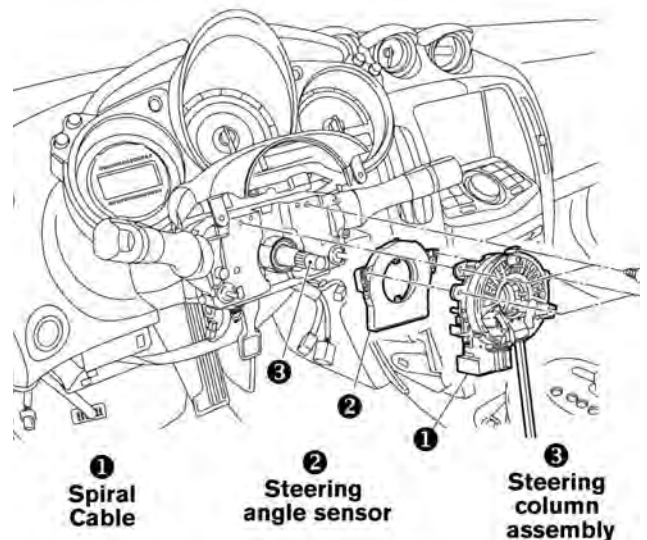

Spiral Cable

SRS connectors are easy to work with, if you know how they work. They all come apart easily, with almost no force. If a connector seems difficult to disconnect, you haven't found its secret yet. Resist the urge to indiscriminately pry on connectors with a pocket screwdriver; check for the connector operation in the manual instead.

Many SRS connectors contain shorting bars that will short its pins together to prevent accidental deployment due to static electricity or improper testing procedures, but don't take this for granted. Also, keep it in mind when testing, especially when a flow chart test procedure doesn't seem to make sense at first glance. The presence of shorting bars is often considered in the design of diagnostic procedures, but not explained in the procedure. Before deciding there must be a misprint, remember to allow for the existence of shorting bars.

SRS Diagnosis

The first step for diagnosis is observation of the SRS light. When the key is turned to the ON position, it should light for about seven seconds, then go out. This indicates everything is OK. If the light stays on, the airbags or pre-tensioners may have deployed. If the light blinks, there is a current problem. If the light does not come on, there is a problem with the control unit or warning light circuit. This non-intrusive observation is referred to as "User Mode" in the manual, and is designed to inform the vehicle operator (and the technician).

Before diving into diagnosis, test the battery. Low voltage caused by a weak battery will cause all sorts of havoc and will lead to a misdiagnosis if you follow the flow chart without checking this basic element first.

After confirming an SRS malfunction with the warning lamp, use the Nissan CONSULT scan tool to check for current or past trouble codes. If you find codes, check for TSBs before proceeding. You can read through the TSB abstracts on www.nissan-techinfo.com or www.infiniti-techinfo.com, even if you don't have a subscription yet. This way, you'll have access to the most current information, which is especially important if you're working on a late model car.

Nissan usually provides a procedure for diagnosis and repair without using the CONSULT, which can be found in the manual in sections labeled "without CONSULT." However, it almost always takes more time and often provides far less information. A CONSULT will pay for itself quickly in time saved.

You may notice that many of the diagnostic solutions may at first appear to be a bit heavy-handed. Be sure to read carefully! The diagnostic information and flow charts found in the manual do not lend themselves to jumping around while reading. Be sure to start at the beginning of the section and read all the text in order. Don't just jump to the beginning of the trouble code flow chart or scan through text looking for information that seems relevant to the problem at hand.

For instance, if you look at a typical driver's air bag module trouble tree, it may seem at first that the procedure is to test the clock spring with an ohmmeter, then replace the airbag, harness, and control unit. However, if you read carefully, you'll find the intent was to recheck for trouble codes at the end of each step. Don't assume important information will be repeated with each step. Read from top to bottom and pay close attention.

Post Collision Repair

Non-specializing body shops often need help with SRS repairs. You may get calls asking if you "have the special tool to turn off the SRS light." After a collision with airbag activation, several components will need to be replaced to restore system function. You'll find a list of which components to replace in the SRS Airbag section of the manual. The list will vary, depending on the type of impact. Permanent codes will set and cannot be reset with the scan tool or by removing power; the component must be replaced to clear the fault.

Used or "remanufactured" components should never be used. Just because it may be possible to clear permanent codes with a bit of hacking, does not make it a good idea. The idea behind permanent codes is to protect the user from driving with an unreliable component. Erasing the warning and sending the car out in an unsafe condition is unethical, probably illegal, and certainly a liability. |

Intelligent Key Systems: Nissan I-Key

Understanding Nissan's I-Key can be the "Key to Success" in servicing and repairing the Intelligent Key System.

Intelligent Key (I-Key) systems are becoming a very popular option, but when they stop working, vehicle owners can't help but notice. The ability to diagnose and repair Intelligent Key systems provides an opportunity to showcase your high-tech proficiency to customers.

A Battle of Wits: Intelligent Technicians vs. Intelligent Key Systems

One of the chief impediments to good technician productivity is overcoming the knowledge gap when encountering a new system. A diagnosis may very well be "simple" if you already know the players involved and their *modus operandi*, but if you don't know what should be happening, diagnosing the simplest of customer concerns can suck up a lot of time. This article will provide an overview of I-Key systems to help build familiarity and offer a leg-up on your next I-Key encounter.

When an artist begins a painting, he starts with a rough outline of the whole scene. Once the positions of all the elements are roughed in, he can start filling in the details. If instead, he were to start by drawing a single element in detail, he might find that it's too large or small or in the wrong position as work continues, and all the work he put into it would be wasted.

The same approach should be taken when diagnosing a system: First, look at the system as a whole to determine where to focus effort. Start with broad brush strokes: What components are involved? What are their roles? How do they interact? Knowledge of the overall function allows you to focus detailed testing in the appropriate area. Testing components without a logical reason will likely lead to a lot of unnecessary and time-consuming testing.

What is an I-Key System?

An I-Key system is a passive entry, starting, and vehicle customization system. A driver can unlock the doors and trunk, start the car, and restore memorized seat and mirror adjustments without ever removing the I-Key from his pocket. Typically, each registered key can have a separate set of user preferences stored in the BCM, which can either be memorized during use or programmed via the CONSULT.

Components of an I-Key System

I-Key

The I-Key looks similar to a standard keyless entry remote. It typically will have lock, unlock, and trunk buttons. However, unlike a standard keyless entry system, the user does not need to press these buttons to enter the car. The I-Key responds to ID requests issued by interior or exterior key antennas. Each I-Key stores its unique ID number and a vehicle ID number.

The I-Key is powered with an internal 3V battery, and cannot receive or transmit without power. The most common "failure" of the I-Key is the battery. Many Nissan and Infiniti cars have a handy low battery warning indicator on the dash to alert the driver (or technician) that the battery needs to be replaced. If either the I-Key battery or the vehicle's 12V battery goes



The I Key will not work without a good battery.

dead, there is a mechanical key insert in the I-Key that will allow emergency entry. Typically, up to four I-Keys can be registered to a vehicle, and once an I-Key has been registered to a particular vehicle, it cannot be registered to another, just as once a conventional key is cut, it cannot be cut again.

Exterior Key Antenna

There are typically three exterior key antennas: one for the driver's door, one for the passenger front door,

and one for the trunk/hatch area. Each has a range of about three feet. The key antennas broadcast a request periodically. It asks something like, "Is there an I-Key within my detection zone?" The antennas will continue this request over and over. If a key is detected, the antenna will ask, "What is your ID number?" If the ID matches, access will be granted. If no keys are detected for a while, the request will become less frequent to save power. If no keys respond for a very long time, the key antenna will go to sleep until the door handle is touched.

Touch Sensors

Touch sensors are built into the driver's and passenger's front door handles, and sometimes the hatch handle, although usually the hatch handle is a push switch instead. The reason for the touch sensor is to alert the car that the driver wants to get in, and isn't just passing by (you wouldn't want your car to unlock every time you walked past, would you?). If the key antennas aren't asleep, the door lock actuator will typically unlock the door before the handle can be pulled, so the passive entry is pretty seamless. On cars with a rear hatch switch, the experience is a little different. The handle must be pulled twice to open the hatch, once to alert the BCM that the driver wants to get in, and again to pull the hatch up.

Interior Key Antennas

Interior key antennas work just like the exterior key antennas. There are usually three detection zones: the driver's seat, the front passenger's seat, and the trunk/hatch area. The interior antennas don't start to cycle until they either receive a signal from the door switch, or a key is authenticated after communicating with the exterior key antenna (depending on the vehicle).

There's no point in using battery power to cycle the interior antennas until they are needed. If a driver enters the car, but does not try to start it for quite some time, the interior antennas will stop cycling to save power, but once the Push Button Ignition Switch is pressed, the antennas will resume cycling again.

Push Button Ignition Switch

The Push Button Ignition Switch (Start Button) and brake pedal switch are used to select the power mode, just like the ignition switch did (and does) on vehicles without I-Key systems. Like ignition switch-equipped vehicles, there are four modes of power:

1. OFF/LOCK
2. ACCESSORY
3. ON
4. RUN/READY

The Start Button is a redundant switch, capable of setting a code if one of its switches changes and the other does not. The Start Button is also an output, and indicates the power mode through the familiar ignition switch markings: LOCK, ACC and ON.

Assuming a registered key has been detected in the vehicle, a single press of the Start Button without stepping on the brake will switch the power mode to ACC. If the button is pressed again, the power mode will change to ON. If the brake pedal is pressed and the



Start Button is pressed again, the engine will start up (or READY on hybrid vehicles). It is possible (and typical) to bypass ACC and ON, and go straight from OFF to RUN/READY by stepping on the brake and pressing the Start Button after entering the vehicle.

Key Slot

The key slot is not just a "holder" for the I-Key. The slot has a switch so the BCM can tell whether or not the key is inserted into the slot, and it also has an antenna/amp that can communicate with I-Key, even if the I-Key battery is dead or missing. This provides a way for the owner to get home should his I-Key battery go dead. Knowing this type of information can make you a hero to call-in customers.



It may be hard to tell when hybrid vehicles “start”. Check the Ready light to determine whether the power mode has changed and the car is “running.”



The key slot is not just a “holder”.

Brake Switch

You may have already realized this, but a bad brake switch will cause a no-start. It is an important input for the I-Key system. Usually the same switch is used for both the brake lights and the I-Key system, so it's easy enough to check quickly.


Door Switches

The door switches are not just for courtesy lights anymore, they are also an important input for the I-Key

system. On some vehicles, the door switch signal alerts the BCM to begin cycling the internal key antennas. The door switch also alerts the BCM if the driver is exiting the car, which allows for warnings, if necessary, and passive door locking.

Transmission Range Switch (or Parking Pawl Position Learn on Hybrid Vehicles)

The engine will not start (or READY on hybrid vehicles) if the parking pawl is not engaged. The shift position switch and circuit must be functional (and the vehicle must be in Park) in order to start the car. This is usually easily checked by looking at the dashboard indicator, and most vehicles with the I-Key system will display a warning message indicating Park should be engaged before trying to start. A low 12V battery can cause an incomplete cycle of the parking pawl servo on

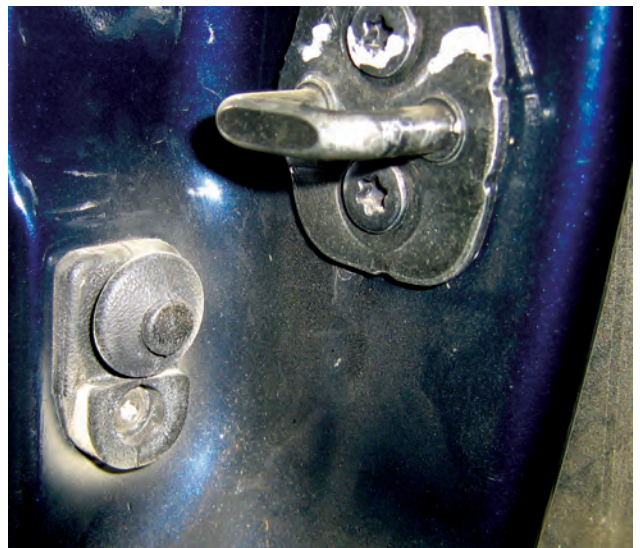

Door switches are important inputs on modern cars.

hybrid vehicles, and then a no-start after 12V power is restored. Cycling in and out of park will allow the parking pawl position to be re-learned, and the car will then READY.

BCM

The Body Control Module is typically the primary controller for the I-Key system. It communicates with the IKey through the antennas, monitors I-Key inputs, requests the Intelligent Power Distribution Module (IDPM) to change power mode among OFF, ACC, and ON, and performs mutual



The transaxle must be in park to start the engine or Ready.

NVIS/IMMOBILIZER authentication with the ECM (or HV ECU on hybrid vehicles) to allow RUN or READY.

IPDM

The IPDM is a multi-function device, but as it relates the I-Key system, it is a control unit that contains integral relays that supplant the need for a traditional ignition switch. Think of it as the ignition switch with a “brain” that follows orders issued by the BCM.

ECM/HV ECU

The BCM and IPDM work together to control the power mode, but in order to start the engine or READY, the ECM or HV ECU must approve. Typically, the BCM holds one ID code for the I-Key, and the ECM or HV ECU holds the other ID code for the Nissan Vehicle Immobilizer System (NVIS).

If an I-Key is added, or a BCM is replaced, the other components must be “told” about it with the CONSULT or the car will not start after the replacement. Due to regulations, however, if the ECM is replaced with a new unit (meaning a “virgin” that’s never been energized on-board), the following procedure will accomplish the re-communication without the need for a CONSULT:

1. Install ECM.
2. Using a registered key, turn the ignition switch to ON using the key (except for card plate key) that has been used before replacement of the ECM.
3. Keep the key in the ON position for at least five seconds.
4. Turn the ignition switch to OFF.
5. Start the engine. If it does indeed start, the procedure is complete. If it won't start, refer to the CONSULT-II Operation Manual NATS-IVIS/NVIS and initialize the control unit.

NOTES:

- When registering new key IDs or replacing the ECM

with a unit that's not brand new, refer to Consult-II Operating Manual NATS-IVIS/NVIS.

- If multiple keys are attached to the key holder, separate them before starting.
- Distinguish keys with unregistered key ID from those with registered ID.

Behaviors

If the I-Key is removed from the vehicle, the power mode will not change. So, if the driver exits the vehicle with the power mode in ACC or ON, the 12V battery may be dead upon his return, although some vehicles have an ACC time-out that may save the battery from complete discharge. If the I-Key is taken from the car after starting, the car will continue to run and drive, but will not restart unless the I-Key is returned to the cabin.

Power mode is also retained if the 12V battery is disconnected, or if it discharges. If you find a vehicle that is in ACC or ON after connecting a jumper pack, you have probably also found the reason for the discharged battery.

Warning beepers sound to alert the user of bad choices, such as exiting the vehicle with the I-Key while in ACC or ON, trying to lock the key in the car, or failing to engage Park before getting out of the car. But not all poor choices result in a warning. For instance, it's possible to pass the key through the window to a friend and then drive away without the key. All of this type of information can be found in the owner's manual, and may not seem appropriate for a technical article. However, you'll likely find the majority of I-Key customer complaints, such as, “It was making a beeping noise as I left, and when I came back it wouldn't start,” can be solved with information found in the owner's manual.

Putting Your I-Key Knowledge to Work

Once you've verified the customer complaint as described (hopefully accurately and in good detail), the first step is to determine whether or not the condition is abnormal. If it is, take inventory of which functions are working and which are not. For instance, if the customer states that he cannot enter the driver's door with the I-Key in his pocket, don't just verify that the complain is accurate; check other functions as well. Can you enter through the passenger side? Does the unlock button on the I-Key work? Does the trunk open? Does the driver's actuator cycle with the interior lock button? You get the idea -- by finding out what's working and what's not, you can overlay your knowledge of the I-Key system players and their roles, and focus your attention accordingly. |



SHIFT the way you move



Optimized design and tuning for each specific Nissan model

Every part tested over 2 million miles



Tested in extreme temperatures

Often Copied, Never Duplicated.

Trust the Original. Genuine Nissan Parts.

When a new car is being engineered, literally thousands of parts are individually designed, created and adapted specifically for that model. Genuine Nissan OE replacement parts deliver model-specific engineering, perfect fit and like-new performance.

Get the right part and get it fast. Your local dealer has an extensive inventory in stock and ready to go.

Nissan Genuine Parts carry a limited warranty for 12 months/12,000 miles.



WANTED: MORE SMART SHOPS TO BUY GENUINE NISSAN PARTS. \$50 REWARD*


For a limited time receive 60 Parts Reward Points for your purchase of \$250 or more from your local Nissan dealer. To claim your reward go to AdvantageAwards.com/NNA and use promo code **PR250**.

Nissan and Advantage Awards offer you the most comprehensive online reward catalog available in the repair industry. Parts Reward Points are issued to enrolled repair shops on qualifying Genuine Parts purchases from participating Nissan and Infiniti dealers**.

*Enrollment in Parts Rewards required. 60 Parts Reward Points can be used to receive gift cards with a value of up to \$50 (Cabella's, Target, Amazon.com and more). Points have no actual cash value. Limited to one transaction per installer. To claim your reward visit AdvantageAwards.com/NNA. Enter code PR250 to receive your extra points. Offer expires 9/15/2011.

**See your participating dealer for details and enrollment information.

| Body Basics Premier Products

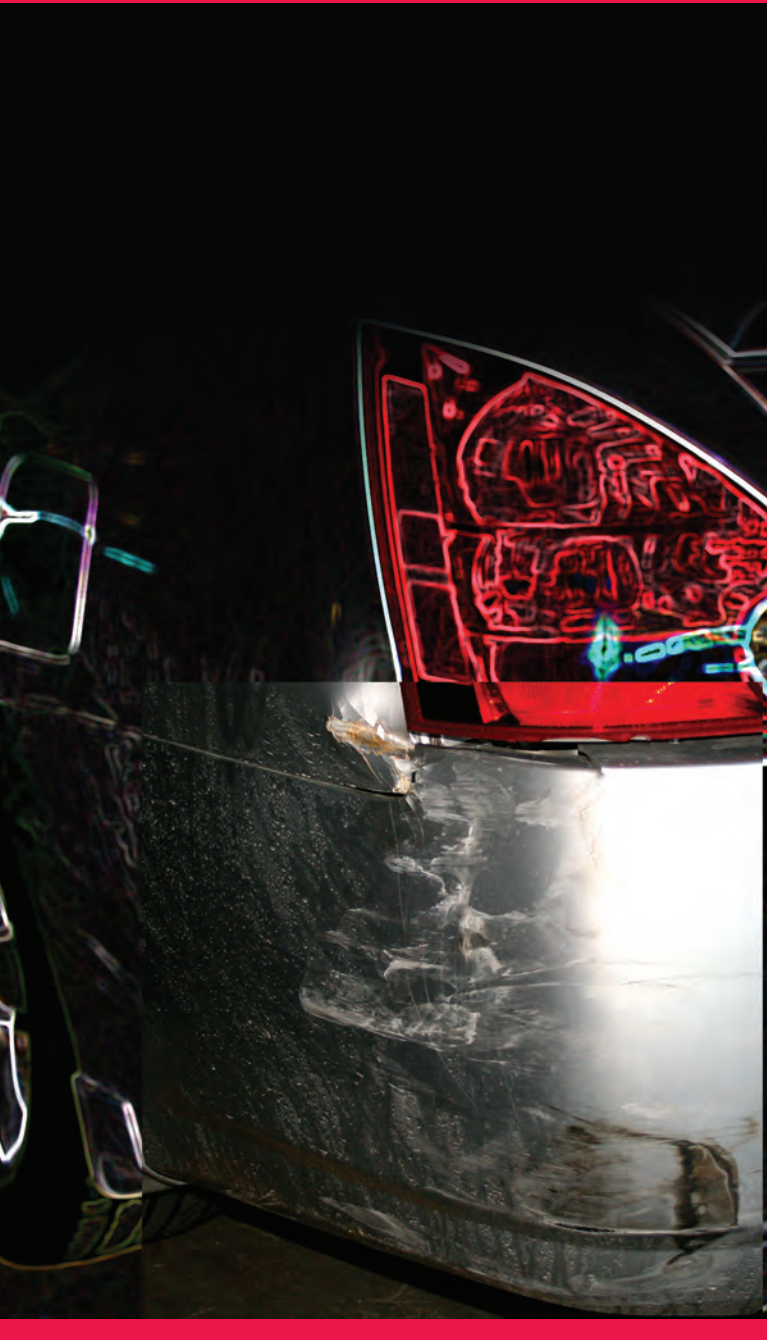

Who knows better which body finishing tools and products work best than the manufacturer of the vehicle? Nissan thoroughly researches and tests the products used in the manufacture of its Nissan and Infiniti vehicles. The same scrutiny goes into deciding what tools and products should be used in Nissan and Infiniti dealers for repairing and servicing vehicles. These same tools and products are available to independent aftermarket body service and collision facilities.

It makes sense to use these Nissan-approved tools and products to return the vehicle to its factory-new condition. The vehicle will not only look and perform the way it was designed, but the customer will be satisfied that the vehicle still maintains its original beauty and integrity.

Body Alignment Equipment

The best end results begin with properly straightening and aligning the body. The body is the structure that holds the rest of the vehicle together. If it's not properly straightened, the components attached to it will not be correctly aligned. To achieve the best results, a high-quality, full-function body straightening and alignment system must be used. Nissan has thoroughly tested the best alignment systems available on the market today and mandates them for Nissan and Infiniti dealerships. These same systems are also available to independent aftermarket collision facilities. Nissan recommends the use of a modern three-dimensional electronic measuring, and/or fixture system with an anchoring and straightening rack or bench to allow 360° pulling. Additionally, of course, the use of Nissan body dimension data for damage analysis and repair is the very best way to go.

In this installment, we'll look at the benefits of using Nissan-approved body alignment equipment and associated tools, bonding and mating products, surface prep, paint and finish products and tools.

Frame Racks

Among the Nissan-approved frame racks are:

- The BenchRack Series, the Mark 6 Series Bench Systems and the SPEED Plus Frame & Lift from the CAR-O-LINER Company.

The BenchRack Series offers several models and optional component packages to tailor the system to your own needs.

The Mark 6 Bench System is a movable system with an incorporated lift and improved lifting capacity.

The SPEED Plus Frame & Lift is ideal for light duty sheet metal pulling and pulls from both ends to keep your full-size alignment bench free for structural repair.

- The EZ Liner Express Portable Structural Repair System and the Impulse System from Chief Automotive Technologies.

The EZ Liner features five tons of power in a smaller, high-quality collision pulling system.

The Impulse System offers power and performance, versatility and options in one affordable package.

- The Power-Pro Series Collision Repair Rack from Blackhawk.

The Power-Pro SL series of racks feature an extended-height lifting capability for ergonomic working heights, an open front and rear for greater accessibility to the vehicle for repairs, a faster pinch-weld anchoring system with fewer bolts to secure it to the rack platform and 60% more chain tie-downs for efficient vehicle tie backs.

Each of these alignment systems has unique qualities and offers a range of purpose, sophistication, accessories and value. All are available through the Nissan Tech-Mate website at www.nissantechmate.com.



The SPEED Plus Frame & Lift from the CAR-O-LINER Company.



The Impulse System from Chief Automotive Technologies



The Power-Pro series repair rack from Blackhawk.



A good assortment of accessory pulling tools and devices helps make the work go quicker and easier.



Use accessory pulling tools to save time and get the proper measurements.



The Velocity measuring system from Chief Automotive Technologies.

Using accessory pulling tools and devices makes the work go quicker, smoother and more completely, resulting in the best alignment and body straightness. The components will fit better and the finished repair will look more professional. When selecting a rack system, make sure you can procure and use a variety of add-on tools for optimal results and quicker labor time for the highest profit margin and customer satisfaction.

Computer Measuring Systems

Using a computerized measuring system is the quickest, most accurate way to effect body straightening and alignment. Many good systems are on the market. Nissan offers the Velocity system from Chief Automotive Technologies through the Nissan Tech-Mate website at www.nissantechmate.com. The Velocity system is highly sophisticated, yet simple to learn and operate. It features a fast and easy set-up with full-color one-page reports on the exact condition of the vehicle's frame before, during, and after repairs have been made, thus offering indisputable evidence of damage severity and quality repairs.

Bonding and Mating Products

The importance of using the correct bonding and mating products for each procedure cannot be overemphasized. One "glue" does not work for all applications. Various adhesives are required for different applications. The best adhesive for metals, plastics or composites to components of the same or different type will ensure a strong bond while offering flexibility where needed. Be sure to research the best choice before making a mistake that could jeopardize the entire repair. Nissan has approved 3M bonding and mating materials for use on the company's vehicles. Other companies may offer bonding and mating products that may also meet Nissan approval.

Surface Prep

Surface prep is a critical step in producing a smooth, durable and handsome repair. No amount of paint and polish is going to hide a poorly prepped surface. Always use the proper body fillers, surface prep, buffing and polishing products that meet the manufacturer's specifications.

Nissan approves 3M surface prep tools and products. Other companies may offer surface prep tools and products that also meet Nissan approval.

Paint & Finish Products

If the paint and finish process isn't correct, it may not matter how strong the repair is or whether or not the body alignment is accurate. The first thing the customer – and anyone else who looks at the vehicle – is going to see is the finish. Always use the best and correct products in the finish process.

Nissan has approved several manufacturers for refinishing materials, including the Dupont family of products:

- Dupont
- Spies Hecker
- Standox

There may be other companies who offer paint finish products that meet Nissan's specifications. Please contact your local Nissan and Infiniti dealer to procure these products or further information.

As pointed out in the "All About Waterborne Paint" article in the March 2011 issue of Nissan & Infiniti Tech News, waterborne paint is the new industry standard. The Environmental Protection Agency (EPA) mandated by federal law that all facilities should comply by switching over to waterborne paint and application equipment earlier this year. Please see that article for more information.



Preparing the surface properly will give the best results.



Dupont paints and finish products are approved for use on Nissan and Infiniti vehicles.

Resources

The best source for obtaining many of these Nissan-approved products is the Nissan Tech-mate website at www.nissantechmate.com. The Tech-Mate website can also be accessed through the Nissan and Infiniti Technical Information websites at www.nissan-techno.com and www.infiniti-techno.com, without having to purchase a subscription or logging on.

Using the Nissan and Infiniti technical information websites ensures getting the proper information to get the job done right, the first time and quickly.

Here's a list of Nissan-approved suppliers. Many more companies also offer excellent products for body and collision service:

Aligning Systems

Blackhawk Equipment
www.blackhawkequipment.com
CAR-O-LINER Company
www.car-o-liner.com
Chief Automotive Technologies Inc.
www.chiefautomotive.com

Paint & Finish Products

Dupont
<http://pc.dupont.com>

Bonding & Mating Products and Surface Prep Products
3M
<http://3mcollision.com> |

Continuously Variable Technologies


Let's take a look at Nissan's Continuously Variable Transmission, including a basic overview of its design, and focus on the independent repair shop's role in servicing, diagnosing, and repairing this different means of applying twisting power.



The Continuously Variable Transmission has been around since Leonardo Da Vinci conceived it during the Renaissance. Of course, then there were no machine tools to manufacture it, and no possible applications if you could. Nissan has taken the concept and implemented it to a greater degree than any other vehicle manufacturer. With nearly infinite gear ratios, Nissan is capitalizing on what no other type of transmission can do. The CVT eliminates the primary problem with the internal combustion engine: the fact that peak power and efficiency only occur at a certain RPM ranges. With today's heightened concern over mpg and emissions, there's no wonder why Nissan is using the CVT in many of its new vehicle applications. Will you be prepared to service and repair this next generation of transmission technology?

How it Works

Briefly described, the CVT transmission uses a belt and two pulleys to create different gear ratios. One pulley performs the "input shaft" function, and the other pulley behaves like the "output shaft" on a standard transmission. Each pulley is composed of two moveable conical discs that slide together or apart on an axle (traditionally, these were called "split sheaves"). The Transmission Control Module (TCM) commands one set of discs to move closer or farther away from each other, which will cause the belt to ride higher or lower on the pulley face effectively changing its working diameter. Both pulleys constantly resize, creating different transmission ratios at the whim of the TCM.

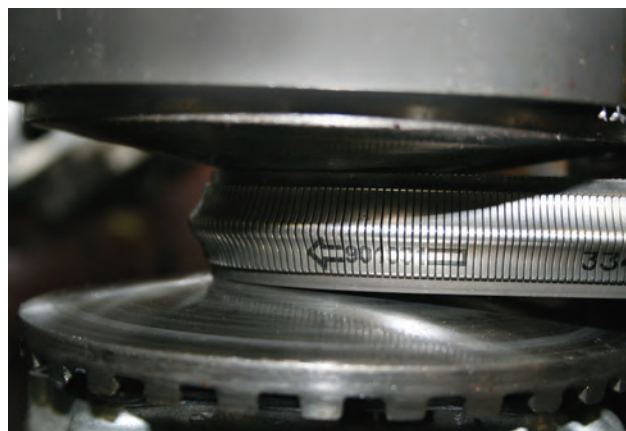

The CVT belt rides between two actuated pulley halves, one set show here.

The computer uses various sensor inputs to calculate the necessary pulley positions.


The belt is an impressive, snakeskin-looking band made up of hundreds of tiny metal plates conjoined with high-strength steel bands. The belt pushes against itself to transmit force, rather than the standard "pulling" behavior of an accessory drive belt. As a result, it lasts longer and should not ever require service or adjustment because of stretching. Wear is minimized by the specialty CVT fluid, which is formulated to prevent the metal of the belt from directly contacting and wearing away the pulley surfaces. Failure to use the genuine NS-2 fluid will damage the transmission, not to mention void your customer's warranty. It may be tempting to use a "multi-purpose" ATF in your customer's CVT transmission considering the cost of NS-2: **Don't do it!**

Considering the potential for error, most CVT-equipped Nissan vehicles do not have a standard dipstick for checking the fluid level and condition. This prevents vehicle owners from inadvertently damaging their transmissions by adding ordinary fluid, but it also requires the use of a shop tool to access the tube as a fill point for service.

CVT Maintenance

Nissan uses three different types of CVTs depending upon the vehicle's requirements. The smallest unit, CVT1 (designated JF009E), is found on the Versa and Cube models. The middle unit, CVT2 (designated JF001E), is used for the mid-level Sentra, Rogue and Altima 2.5L models. The largest unit, CVT3 (designated JF010E), is strong enough to handle the power of Nissan's world-famous V6 in the Murano, Maxima, and Altima models.

To check the fluid level and condition of any of the CVT units, begin by warming up the transmission to operating temperature (between 122 and 176 deg. F.). As usual, park the vehicle on a level surface, but before turning off the engine you should move the shift selector lever throughout the entire shift range and return it to the "P" position. Locate the CVT fluid level gauge, which will have a locking mechanism that requires the use of a small pick to release the dipstick. Remove the dipstick, wipe it off, and rotate the stick 180 degrees prior to reinserting so it doesn't lock. Check the level and note the condition. Add fluid through this tube, which Nissan calls the "charging pipe," as necessary.

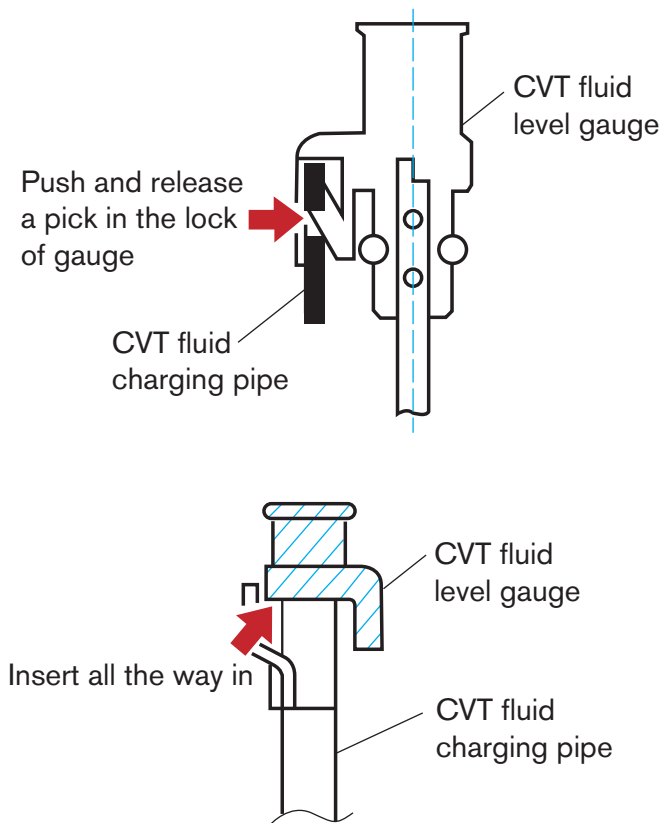

The Nissan CVT dipstick is designed to lock in place to prevent an unfamiliar technician or operator from adding incorrect fluid


For any CVT unit, Nissan does not have an official drain and fill interval for service, even under severe operating conditions. The only printed requirement is a 15,000-mile inspection of the fluid level and condition. Consult the chart below to determine whether the fluid condition requires service. Some independent shops may adopt a preventive maintenance schedule, but be mindful that the drain procedure requires more labor than it would on a typical automatic transmission and that the fluid is much more expensive!

The CONSULT also includes a work-support function that will check the fluid condition as inferred by the TCM, based on drive cycles and history of calculated load. Connect the CONSULT, enter work-support mode, and check the value for CONFORM CVTF DETERIORTN. A value greater than 21000 requires fluid service.


If the CVT requires service, ensure that the fluid is at operating temperature as mentioned earlier, and locate the outlet cooler line at the radiator. With the engine idling, remove the outlet cooler line and start draining the CVT fluid. At the same time, fill the charging pipe until new fluid comes through the cooler line. Use genuine Nissan NS-2 fluid ONLY! NOTE: About 30-50% extra fluid will be required for this procedure, so be certain to over-estimate the fluid parts cost when discussing the service with your customers. Reconnect the cooler lines, recheck the fluid level, then finish the CVT fluid service by using the CONSULT to clear the above-mentioned value for CVT fluid deterioration. Failure to clear this value may cause unneeded service in the future.

Fluid status	Conceivable cause	Required operation
Varnished (viscous varnish state)	CVT fluid becomes degraded due to high temperatures	Replace the CVT fluid and check the CVT main unit and the vehicle for malfunctions (wire harnesses, cooler pipes, etc.)
Milky white or cloudy	Water in the fluid	Replace the CVT fluid and check for places where water is getting in
Large amount of metal powder mixed in	Unusual wear of sliding parts within CVT	Replace the CVT fluid and check for improper operation of the CVT

Nissan has published a chart to aid in determining whether or not a CVT requires fluid service

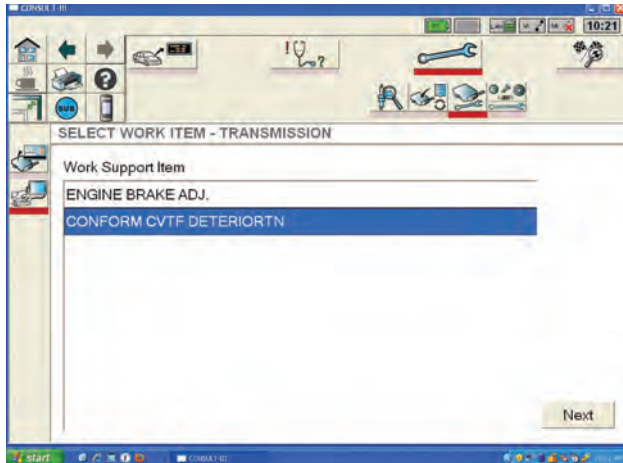

Use the CONSULT to check the health of the CVT fluid according to the transmission control module. Access work support, then find the value.

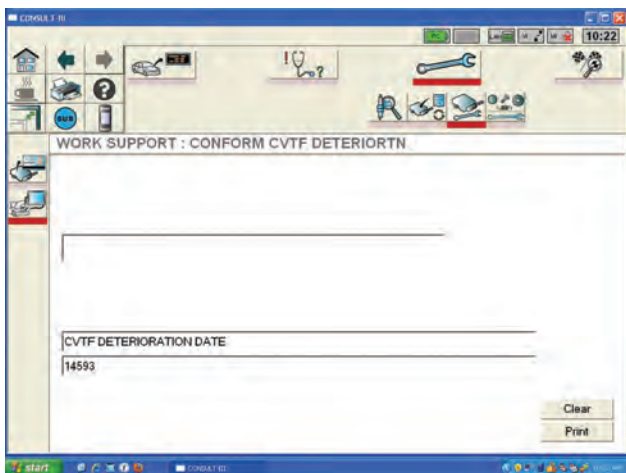

Even if the fluid looks okay, if the value of this field is greater than 21000, you should service the transmission. This transmission's fluid is still within the interval. Use the same window used to clear the fluid deterioration value after service.

According to the Nissan service manual, repeat the above fluid service twice to perform an official CVT fluid flush. DO NOT use an aftermarket transmission flush machine or fluid exchanger, and do not use any transmission fluid additives. It will damage the CVT unit and void your customer's warranty.

Common CVT Problems and Their Diagnosis

Any major CVT malfunction will likely turn the MIL on with useful DTC information. First, check the fluid level and condition as discussed earlier. Then, connect the CONSULT to the vehicle and run an all-systems call to find relevant DTCs. According to Nissan TSBs, CVT failure typically occurs in one of the following manners: a control issue, a physical transmission defect, or both. Before we proceed with common scenarios, refer to TSB# NTB11-043, which applies to all CVT transmissions from 2007 up. It states that prior to any replacement of the TCM, even as recommended in the repair manual, the additional diagnostic steps of this TSB must be followed. For DTCs P1722 and P0725, there may be other sensor inputs causing problems that must be investigated and repaired prior to condemning the TCM. If P1722 is stored, there could be a malfunction with one of the ABS/VDC sensors or its wiring. If P0725 is stored, there could be a malfunction with the crankshaft position sensor or its wiring. In either case, if the code is accompanied by U1000, there is likely a problem with the CAN communication lines between the TCM and the ECU or ABS computers. Avoid costly and unnecessary repairs by staying up-to-date with the latest TSBs online at www.nissan-techinfo.com

CVT control malfunctions can occur when the TCM or the sensors it relies upon fail. Some failures of the TCM are software-related, and Nissan includes a procedure to reflash the computer without having to replace the transmission control unit. Sometimes, if the transaxle is replaced, TCM reprogramming or replacement may be necessary to complete the repair. Check for TSBs that apply to the vehicle you are currently working on, which will include instruction on how to perform the reflash. Refer also to the March 2011 issue of Nissan & Infiniti Tech News for in-depth information about reflash procedures.

Sometimes, TCM Initialization is required – which is different from reprogramming – and may be necessary after CVT replacement without replacing the TCM, or when using a TCM from another vehicle. First, park the car, and turn the key to engine OFF. Connect the CONSULT, navigate to transmission control, then to the special functions sub menu. For reference, select the TCM part number and calibration data and print a copy. Start the initialization procedure by doing the following:

Nissan & Infiniti Collision Service on High Voltage Vehicles


1. Select Transmission Self-Diagnostic Results.
2. Press and hold the brake pedal.
3. Shift the selector lever to Reverse.
4. Press and hold the accelerator pedal down about one-third, but no more than halfway. The purpose of this step is to get both the wide open throttle and closed throttle position signals to read OFF at the same time.
5. Press Erase.
6. Shift the selector lever to Park. Observe the shift selector position display. There will be a delay for “P” to illuminate if the Initialization was successful. If there was no delay, perform steps 1-5 again. Turn off the ignition for at least five seconds, then verify success and clear all DTCs.

Heavy Lifting: CVT Replacement and Overhaul

When does the transaxle have to be replaced? Usually the customer complaint will include a description of sluggishness or slow acceleration. Check for DTCs, even if the MIL is not on. For example, a sluggish Murano may have a bad CVT unit with P0868 stored, but this fault won't illuminate the MIL. In this particular instance, the valve body can be replaced with upgraded parts. If your shop is equipped to rebuild automatic transmissions, this procedure may be a viable alternative to total CVT replacement.

Some internal failures of the CVT2 found in the Sentra, for example, may result in a whine or grind noise that changes in pitch with acceleration, or persists at highway speeds. This failure is mechanical and won't set a fault. Again, if your shop is inclined to overhaul transmissions, follow the Nissan published procedures for complete CVT disassembly, inspection, and repair. Bear this in mind, however, that servicing the Nissan CVT requires special service tools in order to pull bearings or races. You will also need to calculate the size of the shims used in the overhaul, and the CONSULT-III includes an application for this. Without the special service tools and the CONSULT, your shop should replace the entire CVT unit instead.


Be certain to perform traditional diagnostic checks first. Access the ECU for faults and check for individual

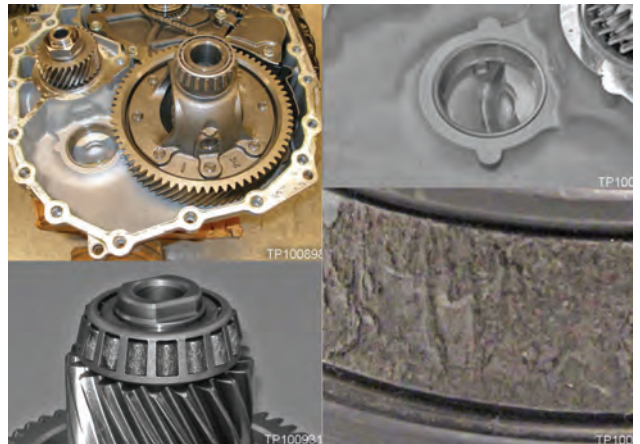

Inspecting the differential reduction gear roller bearing. Be warned! If there is similar damage on both the roller bearings and the inner race, and the outer race can be moved by hand within the CVT case, there is no overhaul possible. You must purchase a new CVT unit.

part failure. The customer's complaint may be caused by a bad wiring harness on that particular circuit, or the part itself. DTCs P0845 and P0840 correspond to the two pressure sensors that the TCM uses to make gear ratio decisions. Many times the TCM is at fault for interpreting the signals incorrectly, but be sure to verify that the sensors are operating within published specifications. It would be wasteful to replace the TCM or perform a recalibration before checking whether or not the sensor works in the first place.

The CVT also uses a torque converter, which can fail to lock up in the same manner as typical automatic transmission systems. If P0744 is stored, the transmission may indeed be slipping; however, there could also be the possibility that the TCM cannot perform the lock-up if the torque converter clutch (TCC) lock solenoid is bad. Perform simple checks to confirm that the solenoid actuates when commanded, and that the clutch locks. Be sure to clear the fault, too, if it's the first recorded incident of failure. Test drive the vehicle with the CONSULT, and monitor live data PIDs to see if DTC P0744 returns immediately under the right circumstances (accelerator pedal depressed at least one eighth, transmission in “D”, constant speed greater than 25 mph). If the problem is very intermittent, you may be replacing the transmission unit or the lock-up solenoid prematurely on a “hunch.”

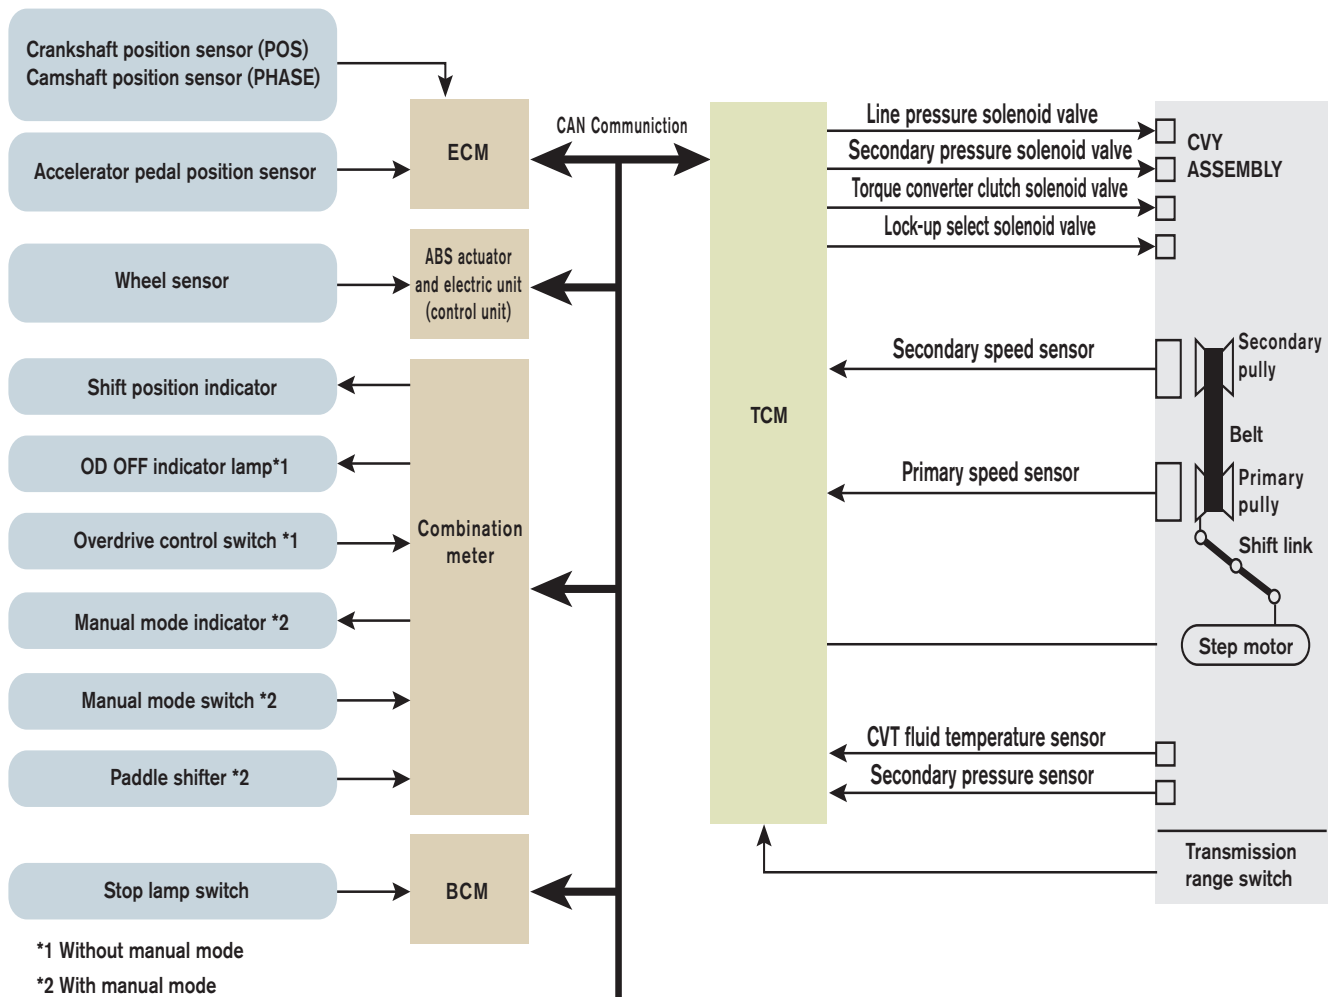

CVT operation depends on many inputs from CAN communications, as well as typical on-board control solenoids. Be sure to verify all systems are operational before condemning the transmission itself.

The Future of Transmissions?

The CVT may start leaking fluid eventually. The independent shop needs to be able to identify and repair possible external fluid leaks. Axle seals, case joints, switches or sensors can all leak the expensive NS-2 fluid. Nissan has actually released a special TSB about leak detection on CVTs, and that fluorescent dye should be used to distinguish between CVT fluid and factory lubricants used at the time of assembly, or corrosion prevention chemicals. The recommended dye is available from Nissan Tech-Mate in a six-pack. Contact Tech-Mate at 1-800-662-2001 and order part number J-28431-6.

Considering the advantages of the CVT, it is an excellent advance in Nissan's continual efforts to increase the power and efficiency of its vehicles. The CVT contributes to better fuel economy because engine RPM stays fairly constant. Likewise, with lower engine speeds, there are fewer harmful exhaust emissions. Furthermore, a CVT has fewer moving parts than standard gear-driven automatic transmissions. The simplicity means decreased expenses for both manufacture and repair. Nissan has invested heavily in its CVTs, and you should plan to invest time and effort in learning to service them. |

Nissan & Infiniti Program Dealers

ALABAMA

BESSEMER
MOORE NISSAN
205.428.6314

BIRMINGHAM
CROWN NISSAN
205.823.5266

BIRMINGHAM
JIM BURKE NISSAN
205.278.5904

FAYETTEVILLE
SUPERIOR NISSAN
479.442.4251

HUNTSVILLE
LANDERS MCLARTY NISSAN
256.830.0266

MOBILE
PAT PECK NISSAN
251.470.5052

ALASKA

ANCHORAGE
CONTINENTAL NISSAN/ANCHOR
907.334.6230

ANCHORAGE
INFINITI OF ANCHORAGE
907.272.4022

ARIZONA

AVONDALE
AVONDALE NISSAN
888.856.3322

CHANDLER
POWER NISSAN CHANDLER
480.461.4358

MESA
COULTER INFINITI
877.415.3521

MESA
EARNHARDT'S NISSAN/SUPER
480.324.8880

MESA
LARRY H. MILLER NISSAN MESA
480.655.4060

PEORIA
INFINITI OF PEORIA
623.583.5701

PEORIA
PEORIA NISSAN
623.523.6250

PHOENIX
ABC NISSAN
602.264.3666

PHOENIX
MIDWAY NISSAN
602.866.6650

SCOTTSDALE
INFINITI OF SCOTTSDALE
480.424.3211

SCOTTSDALE
PINNACLE NISSAN
480.368.4050

TEMPE
POWER NISSAN TEMPE
480.598.6111

TUCSON
INFINITI OF TUCSON
520.690.1500

TUCSON
JIM CLICK NISSAN
520.884.4130

TUCSON
THOROUGHbred NISSAN
520.618.6500

ARKANSAS

NORTH LITTLE ROCK
NORTH LITTLE ROCK NISSAN
501.604.3955

CALIFORNIA

ALHAMBRA
ALHAMBRA NISSAN
626.289.7802

ANTIOCH
ANTIOCH NISSAN
925.281.5050

BAKERSFIELD
NISSAN OF BAKERSFIELD
661.396.4035

BAKERSFIELD
INFINITI OF BAKERSFIELD
661.617.2020

CARSON
CARSON NISSAN
310.221.5121

CATHEDRAL CITY
PALM SPRINGS NISSAN
760.328.2828

CERRITOS
CERRITOS INFINITI
562.405.3535

CERRITOS
CERRITOS NISSAN
800.396.7278

CHICO
CHICO NISSAN INC
530.891.0202

COLMA
SERRAMONTE NISSAN
650.488.2870

CONCORD
DIRITO BROS CONCORD NISSAN
888.899.4173

CONCORD
NIELLO INFINITI
925.676.9592

CORONA
CORONA NISSAN
800.553.7438

DOWNEY
DOWNEY NISSAN
888.444.1355

DUARTE
PERFORMANCE NISSAN
866.540.6959

DUBLIN
DUBLIN NISSAN
952.452.8020

EL CAJON
MOSSY NISSAN EL CAJON
619.401.2068

EL MONTE
ROSS NISSAN OF EL MONTE
800.411.0554

ELK GROVE
INFINITI OF ELK GROVE
916.405.7005

ELK GROVE
NISSAN OF ELK GROVE
916.405.5010

ESCONDIDO
PERRY INFINITI
760.796.5500

FAIRFIELD
MOMENTUM NISSAN
707.402.3200

FONTANA
FONTANA NISSAN
800.417.2451

FRESNO
LITHIA NISSAN OF FRESNO
559.435.3500

GARDENA
GARDENA NISSAN INC
310.527.9215

GLENDALE
GLENDALE INFINITI
818.547.0520

GLENDALE
GLENDALE NISSAN
818.547.5550

GOLETA
SANTA BARBARA NISSAN, LLC
805.964.2990

HAWTHORNE
POWER NISSAN OF SOUTH BAY
310.536.4000

HUNTINGTON BEACH
SURF CITY NISSAN
714.500.6040

IMPERIAL
ROGERS & ROGERS NISSAN
760.352.2900

IRVINE
OC NISSAN-IRVINE
800.515.4797

LOS ANGELES
NISSAN OF DOWNTOWN L.A.
888.576.4560

LOS ANGELES
UNIVERSAL CITY NISSAN INC
818.980.0655

MILLBRAE
DALAND NISSAN INC
650.697.8394

MISSION HILLS
NISSAN OF MISSION HILLS
818.408.5870

MISSION VIEJO
INFINITI OF MISSION VIEJO
949.916.4224

MODESTO
CENTRAL VALLEY NISSAN INC
209.526.9736

MONROVIA
METRO INFINITI
800.600.4493

MONTCLAIR
INFINITI OF MONTCLAIR
909.621.0391

NAPA
NAPA NISSAN INC
707.253.1783

NATIONAL CITY
MOSSY NISSAN INC
619.263.7251

OCEANSIDE
MOSSY NISSAN OCEANSIDE
760.720.7856

ONTARIO
EMPIRE NISSAN INC
800.994.8881

ORANGE
STADIUM NISSAN
714.633.4264

OXNARD
TEAM INFINITI
805.288.5155

OXNARD
TEAM NISSAN
805.485.2910

PALMDALE
ANTELOPE VALLEY NISSAN
661.274.9556

PETALUMA
NORTH BAY NISSAN INC
800.788.0772

REDLANDS
METRO NISSAN OF REDLANDS
888.505.9211

REDWOOD CITY
PENINSULA INFINITI LLC
650.569.4228

RICHMOND
HANLEES HILLTOP NISSAN
510.222.4900

RIVERSIDE
RIVERSIDE NISSAN
951.688.9420

RIVERSIDE
RIVERSIDE INFINITI
800.919.8130

ROSEVILLE
FUTURE NISSAN, INC
916.677.5251

ROSEVILLE
SACRAMENTO INFINITI INC
916.782.2253

SACRAMENTO
MAITA'S NISSAN SACRAMENTO
916.486.8743

SAN BERNARDINO
NISSAN OF SAN BERNARDINO
877.331.3647

SAN DIEGO
KEARNY MESA INFINITI
858.573.1755

SAN DIEGO
MOSSY NISSAN KEARNY MESA
858.565.4411

SAN DIEGO
PACIFIC NISSAN
800.365.6429

SAN JOSE
BESHOFF INFINITI
408.531.3030

SAN LEANDRO
SAN LEANDRO NISSAN
510.347.3003

SAN LUIS OBISPO
COAST NISSAN
805.786.2928

SANTA CLARA
FRONTIER INFINITI
408.243.4355

SANTA CLARA
STEVENS CREEK NISSAN
408.557.5549

SANTA CRUZ
SANTA CRUZ NISSAN
831.426.5100

SANTA MARIA
SANTA MARIA NISSAN
805.925.0077

SANTA MONICA
SANTA MONICA NISSAN INC
310.998.2262

SANTA MONICA
SANTA MONICA INFINITI
310.828.4424

SANTA ROSA
NISSAN OF SANTA ROSA
707.545.4500

SELMA
SELMA NISSAN
559.891.2896

SIMI VALLEY
FIRST NISSAN
805.526.5007

SIGNAL HILL
HOOMAN NISSAN LONG BEACH
800.973.3689

SUNNYVALE
NISSAN SUNNYVALE
408.470.4150

TEMECULA
QUALITY NISSAN/TEMECULA
951.587.3772

THOUSAND OAKS
NISSAN OF THOUSAND OAKS
888.705.4441

TORRANCE
INFINITI SOUTH BAY
310.517.0570

TUSTIN
INFINITI TUSTIN
714.832.6252

TUSTIN
TUSTIN NISSAN
714.669.8288

VALENCIA
NISSAN OF VALENCIA
866.751.0234

VAN NUYS
MILLER NISSAN INC
818.374.4493

VICTORVILLE
VALLEY HI NISSAN
888.293.7762

VISALIA
NISSAN OF VISALIA
559.741.2274

WEST COVINA
WEST COVINA NISSAN
626.388.9300

WESTMINSTER
ORANGE COAST INFINITI
714.650.8585

WESTLAKE VILLAGE
INFINITI OF THOUSAND OAKS
805.230.8262

WOODLAND HILLS
WOODLAND HILLS NISSAN
818.577.2723

COLORADO

AURORA
INFINITI OF DENVER
303.671.2596

AURORA
TYNAN'S NISSAN INC
303.341.3214

CENTENNIAL
GO NISSAN ARAPAHOE
303.790.7333

COLORADO SPRINGS
SOUTH COLO SPGS NISSAN
719.550.3041

COLORADO SPRINGS
WOODMEN NISSAN
719.234.1060

DENVER
GO NISSAN 104TH
303.738.4330

ENGLEWOOD
LARRY H. MILLER NISSAN
720.274.5243

GREELEY
EHRlich NISSAN
970.353.2065

LAKEWOOD
EMPIRE LAKEWOOD NISSAN
303.232.3009

LITTLETON
MIKE WARD INFINITI
303.350.4300

LITTLETON
GO NISSAN SOUTHWEST
303.738.4330

CONNECTICUT

HARTFORD
HARTE INFINITI INC
877.791.7276

HARTFORD
HARTE NISSAN INC
860.541.6942

MANCHESTER
DECORMIER MOTOR SALES INC
860.643.4165

MIDDLETOWN
MIDDLETOWN NISSAN LLC
860.632.6400

MILFORD
NAPOLI NISSAN
203.877.5607

NORTH HAVEN
EXECUTIVE NISSAN
888.479.5890

SHELTON
D'ADDARIO NISSAN
800.998.6978

WEST SIMSBURY
HOFFMAN NISSAN
860.658.3340

WILTON
BRUCE BENNETT NISSAN
203.544.8371

DELAWARE

NEW CASTLE
SHERIDAN NISSAN LLC
302.326.6134

NEWARK
PORTER INFINITI
302.368.6305

NEWARK
PORTER NISSAN
302.368.6317

FLORIDA

CLEARWATER
AUTOWAY NISSAN/CLEARWATER
727.507.3200

CLEARWATER
LOKEY MOTOR COMPANY
727.374.2317

CLEARWATER
LOKEY NISSAN
727.450.7989

COCONUT CREEK
INFINITI OF COCONUT CREEK
954.861.6117

CORAL SPRINGS
CORAL SPRINGS NISSAN INC
954.752.9595

DAYTONA BEACH
DAYTONA NISSAN
386.274.6825

FORT LAUDERDALE
MAROONE NIS/FT LAUDERDALE
954.524.2105

FORT MYERS
SUTHERLIN NISSAN
239.267.1359

FORT PIERCE
FORT PIERCE NISSAN
772.464.4645

JACKSONVILLE
ATLANTIC INFINITI INC.
800.642.0200

JACKSONVILLE
COGGIN NISSAN AT THE AVE
904.866.7330

JACKSONVILLE
MIKE SHAD NISSAN/JACKSONV
866.668.8933

LAKELAND
JENKINS NISSAN INC
863.686.2800

MIAMI
BILL SEIDLE'S NISSAN INC
305.635.5478

MIAMI
ESSERMAN NISSAN LTD
305.625.6320

MIAMI
MAROONE NISSAN OF MIAMI
305.444.7868

MIAMI
WARREN HENRY INFINITI
305.654.1572

NAPLES
JOHN MARAZZI NISSAN
239.659.9000

ORLANDO
ORLANDO INFINITI
407.660.0077

ORLANDO
REED MOTORS, INC
407.297.7333

ORLANDO
SUTHERLIN NISSAN OF ORLANDO
407.657.9500

PALMETTO BAY
MAROONE NISSAN OF KENDALL
305.259.2658

PALMETTO BAY
SOUTH MOTORS INFINITI
305.256.2070

PANAMA CITY
JOHN LEE NISSAN
850.785.9561

PEMBROKE PINES
MAROONE NISSAN/PEMBROKE
954.447.2366

PENSACOLA
SANDY SANSING NISSAN INC
850.479.4777

POMPANO BEACH
POMPANO NISSAN, LLC
954.781.7700

SAINTE PETERSBURG
CROWN NISSAN
727.527.8411

SARASOTA
COAST INFINITI
941.922.5723

SARASOTA
GETTEL NISSAN OF SARASOTA
941.923.1411

TALLAHASSEE
KRAFT NISSAN
850.576.6171

TAMARAC
SAWGRASS INFINITI
954.421.0669

TAMPA
COURTESY NISSAN OF TAMPA
877.471.7658

TAMPA
INFINITI OF TAMPA
888.632.3042

ROYAL PALM BEACH
ROYAL PALM NISSAN
888.229.4132

WEST PALM BEACH
INFINITI OF PALM BEACHES
888.229.4132

WINTER HAVEN
HILL NISSAN INC
561.491.7540

GEORGIA

BUFORD
SUTHERLIN NISSAN MALL/GEORGIA
678.714.1602

CHAMBLEE
CAPITOL CITY NISSAN LLC
770.457.4441

CONYERS
CONYERS NISSAN
770.929.8432

COLUMBUS
HEADQUARTER NISSAN
706.225.8100

DECATUR
NALLEY NISSAN
404.292.4774

DULUTH
GWINNETT PLACE NISSAN
770.813.6770

DULUTH
INFINITI OF GWINNETT
800.249.7301

GAINESVILLE
CARRIAGE NISSAN
678.717.0440

KENNESAW
TOWN CENTER NISSAN
770.423.7469

LILBURN
STONE MOUNTAIN NISSAN
678.252.3111

MACON
PAUL WALSH NISSAN INC
478.784.1991

MARIETTA
TEAM NISSAN OF MARIETTA
770.421.8639

MORROW
NISSAN SOUTH
770.968.1360

ROME
HERITAGE NISSAN
706.295.0525

ROSWELL
REGAL NISSAN INC.
770.998.8886

UNION CITY
INFINITI OF SOUTH ATLANTA
678.369.6074

UNION CITY
NISSAN SOUTH UNION CITY
770.306.9817

HAWAII

HONOLULU
INFINITI OF HONOLULU
888.836.7753

HONOLULU
NEW CITY NISSAN
808.545.3111

LIHUE
NISSAN OF KAUAI
808.245.0525

WAIPAHU
TONY NISSAN
808.680.7140

ILLINOIS

ARLINGTON HEIGHTS
ARLINGTON NISSAN/ARLINGTON
847.590.0154

BARRINGTON
MOTOR WERKS INFINITI INC
888.568.3140

CHICAGO
BERMAN'S INFINITI CHICAGO
312.476.8000

CHICAGO
MID CITY NISSAN INC.
888.635.5652

CHICAGO
WESTERN AVENUE NISSAN
773.776.8200

COUNTRYSIDE
CONTINENTAL MOTORS INC
708.354.3745

CRYSTAL LAKE
JIM M'LADY NISSAN
815.459.2296

EVANSTON
THE AUTOBARN NISSAN
800.344.3534

GLENCOE
FIELDS INFINITI
847.998.5200

GURNEE
ROSEN NISSAN OF GURNEE
847.856.0644

HIGHLAND PARK
NORTH SHORE NISSAN
847.433.6656

LIBERTYVILLE
LIBERTY IMPORT CENTER
847.680.1290

LISLE
INFINITI OF LISLE INC
866.874.6346

LOVES PARK
ANDERSON NISSAN INC
815.633.3460

MATTESON
HAWKINSON NISSAN LLC
708.720.2185

MELROSE PARK
AL PIEMONTE NISSAN INC
708.343.6669

NAPERVILLE
GERALD NISSAN, INC.
630.355.0708

NILES
STAR NISSAN INC
847.588.2290

NORTH AURORA
GERALD NISSAN OF N. AURORA
630.907.0867

O FALLON
AUFFENBERG NISSAN
618.622.4646

OAK LAWN
KELLY NISSAN INC
708.425.6659

ORLAND PARK
INFINITI OF ORLAND PARK
708.343.3800

ORLAND PARK
ORLAND PARK NISSAN INC
708.403.1673

PEORIA
UFTRING NISSAN INC
309.690.6230

SAINT CHARLES
NISSAN OF SAINT CHARLES
630.584.3900

SKOKIE
MARTIN NISSAN
847.967.2299

SOUTH HOLLAND
NISSAN OF SOUTH HOLLAND
800.696.4772

ST CHARLES
NISSAN OF ST. CHARLES
630.584.2489

WOOD RIVER
AUTOCENTERS NISSAN INC
618.251.3057

INDIANA

FISHERS
BUTLER NISSAN
866.237.0569

FORT WAYNE
FORT WAYNE NISSAN
260.484.8801

INDIANAPOLIS
ANDY MOHR NISSAN INC
317.298.2015

INDIANAPOLIS
DREYER&REINBOLD INFINITI
317.573.4291

INDIANAPOLIS
ED MARTIN NISSAN
800.731.0228

INDIANAPOLIS
HUBLER NISSAN INC
800.960.9811

INDIANAPOLIS
TOM WOOD NISSAN INC
317.688.6222

IOWA

DES MOINES
WILLIS INFINITI
800.373.1836

DES MOINES
HUMMEL'S NISSAN
515.251.8115

KANSAS

OLATHE
MCCARTHY OLATHE NISSAN
913.232.2624

KENTUCKY

LEXINGTON
GLENN NISSAN
859.263.5020

LOUISVILLE
SAM SWOPE INFINITI
877.333.3410

SOMERSET
DON MARSHALL NISSAN
606.678.8178

LOUISIANA

BATON ROUGE
ALL STAR NISSAN LLC
225.272.9330

BATON ROUGE
INFINITI OF BATON ROUGE
225.756.6199

HARVEY
RAY BRANDT NISSAN INC
504.363.1918

HOUMA
GREG LE BLANC NISSAN
985.447.1111

METAIRIE
PREMIER NISSAN/METAIRIE
504.455.5880

METAIRIE
RAY BRANDT INF/METAIRIE
504.832.2005

MARYLAND

ANNAPOLIS
SHEEHY INFINITI/ANNAPOLIS
888.288.5162

BALTIMORE
ANTWERPEN SECURITY NISSAN
410.298.5369

BALTIMORE
BOB BELL CHEVROLET/NISSAN
410.282.2432

BEL AIR
BEL AIR NISSAN
410.879.1133

CLARKSVILLE
ANTWERPEN NISSAN INC
866.226.4930

ELLCOTT CITY
NORRIS NISSAN WEST
443.549.1260

FREDERICK
FREDERICK NISSAN
301.662.4600

GERMANTOWN
CRISWELL NISSAN
301.670.3900

GLEN BURNIE
SHEEHY NISSAN
877.478.3539

LAUREL
TISCHER NISSAN
800.288.6983

MARLOW HEIGHTS
PASSPORT NIS/MARLOW HEIGHTS
301.423.8400

ROCKVILLE
DARCARS NISSAN
301.309.2200

SALISBURY
POHANKA NISSAN/SALISBURY
410.548.4704

SILVER SPRING
HERB GORDON NISSAN
301.890.3055

TIMONIUM
NATIONWIDE MOTOR SLS CORP
410.252.5834

WALDORF
SHEEHY NISSAN OF WALDORF
301.843.5300

MASSACHUSETTS

AUBURN
BERTERA NISSAN INC
508.832.9611

BEVERLY
ROLAND D. KELLY NISSAN
978.767.4816

BOURNE
NISSAN OF BOURNE
508.759.4400

DANVERS
KELLY INFINITI
866.883.7093

HYANNIS
BALISE NISSAN OF CAPE COD
508.771.3636

LANCASTER
RON BOUCHARD'S NISSAN
978.345.1800

LYNNFIELD
KELLY NISSAN OF LYNNFIELD
866.979.4250

MEDFORD
COLONIAL NISSAN
781.395.5300

NORTH ATTLEBORO
NISSAN VILLAGE
888.309.0980

NORWOOD
INFINITI AUTO OF NORWOOD
888.340.4442

RAYNHAM
MASTRIA NISSAN, INC
800.248.2458

TEWKSBURY
IRA NISSAN TEWKSBURY
978.746.2500

WEST SPRINGFIELD
JERRY ROME NISSAN
413.746.2269

MICHIGAN

FARMINGTON HILLS
SUBURBAN NISSAN / FARM HILL
800.242.8425

GRAND RAPIDS
PFEIFFER INFINITI INC
616.940.8992

KALAMAZOO
COLE NISSAN
269.342.9800

KENTWOOD
FOX NISSAN/GRAND RAPIDS
616.719.5750

NOVI
SUBURBAN INFINITI INC
800.242.8425

OKEMOS
LANSING NISSAN
517.827.0273

TRAVERSE CITY
TRAVERSE CITY AUTO PLAZA
800.852.6475

TROY
SUBURBAN INFINITI OF TROY
248.731.3400

TROY
SUBURBAN NISSAN OF TROY
248.649.2074

MINNESOTA

BLOOMINGTON
FELDMANN IMPORTS INC
952.837.6350

BLOOMINGTON
LUTHER INF OF BLOOMINGTON
952.885.7050

BROOKLYN PARK
BROOKLYN PARK AUTOMOTIVE
763.765.1562

BURNSVILLE
WALSER NISSAN
952.898.7306

GOLDEN VALLEY
JIM LUPIENT INFINITI
763.513.4715

INVER GROVE HEIGHTS
LUTHER NISSAN
800.246.9984

MAPLEWOOD
KLINE NISSAN
651.379.4325

MISSISSIPPI

BRANDON
GRAY-DANIELS NISSAN BRAND
800.530.7989

GULFPORT
PAT PECK NISSAN
228.864.6411

HATTIESBURG
PETRO AUTOMOTIVE GROUP
601.264.4411

JACKSON
GRAY-DANIELS NISSAN NORTH
601.899.7450

TUPELO
CARLOCK NISSAN OF TUPELO
800.808.6481

MISSOURI

COLUMBIA
JOE MACHENS NISSAN
573.443.1660

CREVE COEUR
PLAZA INFINITI
314.301.1702

ELLISVILLE
WEST COUNTY NISSAN
866.536.4795

HAZELWOOD
BOMMARITO NISSAN INC
314.731.8270

KANSAS CITY
MAJOR INFINITI INC
866.382.4971

KANSAS CITY
RANDY REED NISSAN LLC
816.459.4800

SAINT LOUIS
LOU FUSZ MOTOR COMPANY
800.392.1372

SAINT LOUIS
SUNTRUP NISSAN VOLKSWAGEN
314.892.8200

SPRINGFIELD
INFINITI OF SPRINGFIELD
417.616.5581

MONTANA

BILLINGS
BILLINGS NISSAN LLC
406.294.1259

MISSOULA
MISSOULA NISSAN-HYUNDAI
406.721.1100

NEBRASKA

OMAHA
INFINITI OF OMAHA
402.592.2200

OMAHA
NISSAN OF OMAHA LLC
402.493.1945

NEVADA

HENDERSON
HENDERSON NISSAN
702.558.5974

LAS VEGAS
DESERT NISSAN
702.262.0540

LAS VEGAS
PLANET NISSAN
702.839.6138

LAS VEGAS
TOWBIN INFINITI
702.252.8134

LAS VEGAS
UNITED NISSAN
702.207.8032

NEW HAMPSHIRE

MANCHESTER
TEAM NISSAN INC
603.634.4442

NASHUA
INFINITI OF NASHUA
603.888.2446

NASHUA
PETER'S AUTO SALES INC
603.579.5205

NEW JERSEY

AVENEL
SANSONE'S ROUTE 1 NISSAN
732.815.2525

BLOOMFIELD
LYNNE'S NISSAN CITY INC
973.743.8387

BUTLER
ROUTE 23 NISSAN LLC
888.393.4861

CHERRY HILL
CHERRY HILL NISSAN INC
856.667.8010

CLIFTON
FETTE INFINITI, LLC
973.743.3100

ENGLEWOOD
INFINITI OF ENGLEWOOD LLC
800.969.2204

FLEMINGTON
FLEMINGTON INFINITI
800.218.1437

FLEMINGTON
FLEMINGTON NISSAN
800.381.9113

FREEHOLD
DCH FREEHOLD NISSAN
732.780.4660

HAINESPORT
CLASSIC CARS NISSAN
609.267.2886

HASBROUCK HEIGHTS
MEADOWLANDS NISSAN
888.935.7799

KEYPORT
PINE BELT NISSAN/KEYPORT
732.264.4364

MAPLE SHADE
HOLMAN INFINITI
800.523.0285

NEPTUNE
SANSONE JR'S 66 NISSAN
800.274.7121

NEW JERSEY CITY
HUDSON NISSAN
201.435.2003

NORTH PLAINFIELD
NORTH PLAINFIELD NISSAN
800.311.4663

SOMERVILLE
SOMERSET NISSAN
908.722.3600

SOUTH BRUNSWICK
ACME NISSAN
800.367.0269

STANHOPE
LYNNE'S NISSAN WEST INC
800.245.9590

TOMS RIVER
PINE BELT AUTOMOTIV INC
732.349.6878

TURNERSVILLE
NISSAN OF TURNERSVILLE
800.883.0003

WOODBURY
WOODBURY NISSAN INC
856.853.8176

NEW MEXICO

ALBUQUERQUE
GARCIA INFINITI
505.217.3002

ALBUQUERQUE
MELLOY NISSAN
505.266.8588

ALBUQUERQUE
RELIABLE NISSAN
505.897.6001

NEW YORK

ALBANY
ARMORY NISSAN INC
518.641.7672

AMHERST
MIKE BARNEY NISSAN
716.833.6618

BAYSIDE
STAR NISSAN INC.
718.359.7454

BLAUVELT
ROCKLAND NISSAN
845.358.3670

BROOKLYN
BAY RIDGE NISSAN INC.
718.238.4776

BROOKLYN
KING'S NISSAN INC
718.934.3900

BROOKLYN
KINGS INFINITI INC
718.646.3335

GREAT NECK
GREAT NECK NISSAN
516.301.5155

KINGSTON
KINGSTON NISSAN
845.338.3100

OZONE PARK
NISSAN OF QUEENS
877.259.2886

GREENVALE
BARON NISSAN INC
516.621.2299

HUNTINGTON STATION
HABBERSTAD NISSAN INC
631.439.7051

JACKSON HEIGHTS
KOEPEL NISSAN INC
718.898.7800

LYNBROOK
LEGACY INFINITI LTD
877.569.4634

MANHASSET
INFINITI OF MANHASSET
866.382.2266

MASSAPEQUA
MASSAPEQUA NISSAN
631.842.5320

MT. KISCO
NISSAN CITY NORTH
914.242.2800

NEW YORK
INFINITI OF MANHATTAN INC
212.315.0700

PATCHOGUE
NISSAN 112 SALES CORP
631.289.9070

PORT CHESTER
NISSAN CITY/PORT CHESTER
914.937.1777

RIVERHEAD
RIVERHEAD AUTO MALL LTD
631.369.0111

SAINT JAMES
SMITHTOWN NISSAN, INC
631.361.9560

SCHENECTADY
LIA NISSAN
518.370.2121

STATEN ISLAND
S.G. HYLAN MOTORS CORP
718.447.3800

SYOSSET
LEGEND NISSAN LTD
516.496.7385

WEST ISLIP
ATLANTIC NISSAN SUPERSTOR
631.587.2766

WESTBURY
ADVANTAGE NISSAN
516.935.1813

WHITE PLAINS
PEPE INFINITI INC
800.344.7660

NORTH CAROLINA

CHARLOTTE
EAST CHARLOTTE NISSAN
704.535.4012

CORNELIUS
LAKE NORMAN INFINITI
704.237.8008

GREENSBORO
CROWN NISSAN
866.525.9859

GREENSBORO
MODERN INFINITI LLC
888.232.4118

HICKORY
CROSSROADS NISSAN
828.324.5040

MATTHEWS
INFINITI OF CHARLOTTE
704.815.1018

RALEIGH
CROSSROADS INFINITI INC
919.981.5656

RALEIGH
SOUTHERN STATES NISSAN
888.998.0044

STATESVILLE
CLASSIC NISSAN
704.872.8500

WAKE FOREST
CROSSROADS NISSAN
919.435.5740

WINSTON SALEM
MODERN INF/WINSTON-SALEM
336-767-7800

WINSTON-SALEM
MODERN NISSAN LLC
336.744.2142

OHIO

BEDFORD
INFINITI OF BEDFORD
440.359.1453

CINCINNATI
INFINITI OF CINCINNATI
513.563.1200

COLUMBUS
GERMAIN NISSAN
614.418.4506

CUYAHOGA FALLS
RON MARHOFFER NISSAN
330.923.8000

DAYTON
MATT CASTRUCCI NISSAN
800.952.4604

DUBLIN
INFINITI OF COLUMBUS LLC
614.793.2481

HILLIARD
BUCKEYE NISSAN INC.
614.771.2370

LIMA
REINEKE NISSAN
419.227.7400

MAYFIELD HEIGHTS
GANLEY NISSAN
440.449.9500

MEDINA
KEN GANLEY NISSAN INC.
330.721.0509

MENTOR
SUNNYSIDE NISSAN
888.278.2400

STREETSBORO
CLASSIC NISSAN
330.422.7300

TOLEDO
YARK NISSAN
419.842.7532

OKLAHOMA

BROKEN ARROW
NELSON NISSAN
800.364.4600

OKLAHOMA CITY
BOB HOWARD NISSAN INC
405.943.9555

OKLAHOMA CITY
BOB MOORE INFINITI INC
405.748.6086

OKLAHOMA CITY
HUDBURG NISSAN L.L.C.
405.632.0715

TULSA
BOB MOORE NISSAN OF TULSA
918.628.1495

TULSA
JACKIE COOPER NISSAN
888.211.6202


Trust the Original, Use Genuine Nissan/Infiniti Parts.



STOP!

Need to stop on a dime?
Trust your customer's protection to genuine quality parts

Safety
Reliability
Quality
Service
Experience

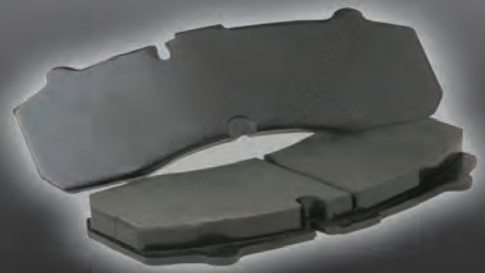

Hitachi Brakes are genuine products.
Why trust your safety to anyone else?



Working together to give your customers the braking power they deserve

www.hitachi-automotive.us

HITACHI
Inspire the Next